

**Comsewogue Union Free School District**

**Districtwide Lead in Drinking Water  
Sampling and Remediation Plan**

**2020**



**2150 Smithtown Avenue  
Ronkonkoma, NY 11779  
(631) 580-3191  
[www.envirohealth.org](http://www.envirohealth.org)**

**Project #20235**

**Districtwide Lead in Drinking Water**  
**Sampling and Remediation Plan**

**Performed for:**

**Comsewogue Union Free School District**  
**290 Norwood Avenue**  
**Port Jefferson Station, NY 11776**

**October 2020**  
**Updated January 18, 2021**

**Prepared by:**

**Enviroscience Consultants, Inc.**  
**2150 Smithtown Avenue**  
**Ronkonkoma, NY 11779**  
**(631) 580-3191**

**Project #20235**

**President**



---

**Glenn Neuschwender**

# **Districtwide Lead in Drinking Water Sampling and Remediation Plan**

## **Table of Contents**

### **I. Executive Summary**

### **II. Sampling Methodology**

### **III. Initial Results**

**Appendix A – Boyle Road Elementary School**

**Appendix B – Clinton Avenue Elementary School**

**Appendix C – Norwood Avenue Elementary School**

**Appendix D – Terryville Road Elementary School**

**Appendix E – John F. Kennedy Middle School**

**Appendix F – Comsewogue High School**

October 28, 2020

Gerald Abbey  
Comsewogue UFSD  
290 Norwood Avenue  
Port Jefferson Station, NY 11776

## **I. Executive Summary**

The Comsewogue Union Free School District has developed their 2020 Lead in Drinking Water Sampling and Analysis Program, as required by the New York State Department of Health (Public Health Law Sections 1370-a and 1110, Subpart 67-4 Lead Testing in School Drinking Water).

In accordance with the regulation, this Lead Remediation Plan is prepared to identify locations deemed as Applicable Drinking Water Sources and report first draw sample results, to mitigate locations where sample results exceed 15 parts per billion, to identify locations deemed as Non-Applicable Water Sources, communicate this designation to building occupants, and to develop strategies for monitoring locations deemed Non-Applicable Water Sources to insure building occupants do not consume water from these locations.

Within the Comsewogue Union Free School District, the following locations have been deemed Applicable Drinking Water Sources by the administration:

- 1) Water fountains and bottle filling stations;
- 2) Kitchen water faucets and pot fillers used in food preparation;
- 3) Ice machines
- 4) Elementary School classroom sinks
- 5) Elementary School bathroom sinks

First draw samples were collected from each of these locations within the District, and analyzed by a New York State Department of Health ELAP certified laboratory. For results at or below 15 ppb, no further action is required until 2025. For locations above 15 ppb, options include: second and third draw sample collection to determine source of lead, designation of the location as Non-applicable Water Source, or permanent removal of the fixture from the location. In either case, the result was communicated by Enviroscience Consultants, and the fixture was shut off by the District immediately upon receipt of results.

The following locations within the Comsewogue Union Free School District were deemed Non-Applicable Water Sources by the administration:

- 1) Science Laboratory sinks;
- 2) Art Room sinks;
- 3) Other classroom sinks;
- 4) Other Bathroom sinks;
- 5) Outside spigots
- 6) Custodial Closet sinks

In these cases, the District has placed signs adjacent to the fixture to notify occupants that the water is not intended for consumption. To further support this protocol, the following management of the locations is required:

- 1) Science Laboratory sinks - communicate in writing with students that these locations are for science experiments and hand washing only, not for consumption. This is most easily accomplished by including this language in the laboratory safety paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective science teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 2) Art Room sinks - communicate in writing to students that these locations are for cleaning of art supplies and hand washing only, not for consumption. This is most easily accomplished by including this language in the course paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective art teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 3) Other classroom sinks - classrooms in this category often include elementary classrooms, where students are to hand wash after bathroom usage or activities as part of a regular hygiene program. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 4) Bathroom sinks - in intermediate buildings, signage should be sufficient for communicating the concept of hand washing only. In elementary schools, personal hygiene should be integrated into curriculum to ensure students understand bathroom sinks are for hand washing only, and not consumption. Further, show what the signage looks like in bathrooms so they learn to recognize its meaning. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 5) Outside spigots - all-weather signage will be installed at each location. Further, spigots will have a special key maintained by the custodial staff to ensure that non-authorized persons do not fill sports coolers or use hoses for consumption. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 6) Custodial Closet sinks - these locations should be accessed by custodial personnel only, and locked when not in use. Access to others should be restricted. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.

## **II. Sampling Procedures:**

In accordance with the regulation, EnviroScience Consultants, Inc. performed initial water sampling throughout the Comsewogue Union Free School District on October 20, 21,& 22, 2020. Samples were collected in wide-mouth 250 milliliter containers and were collected in the morning hours before the facilities opened. The water sources were not used for at least 8 hours and not more than 18 hours prior to sampling. Unique source numbers and designations were assigned to each source location. Unique sample identification numbers were assigned to each sample taken. The key to fixture type codes and the sampling location schematics are shown below.


### **Fixture Type Codes**

BF	Bottle Filler
HB	Hose Bib
IM	Ice Machine
OS	Other Source
PF	Pot Filler
SK	Sink
SL	Supply Line
SP	Spigot
SPY	Spray
SS	Slop Sink
V	Valve
WC	Water Cooler
WF	Water Fountain

### **Source Designations**

App	Applicable
N/A	Non-applicable

## Sampling Location Schematics

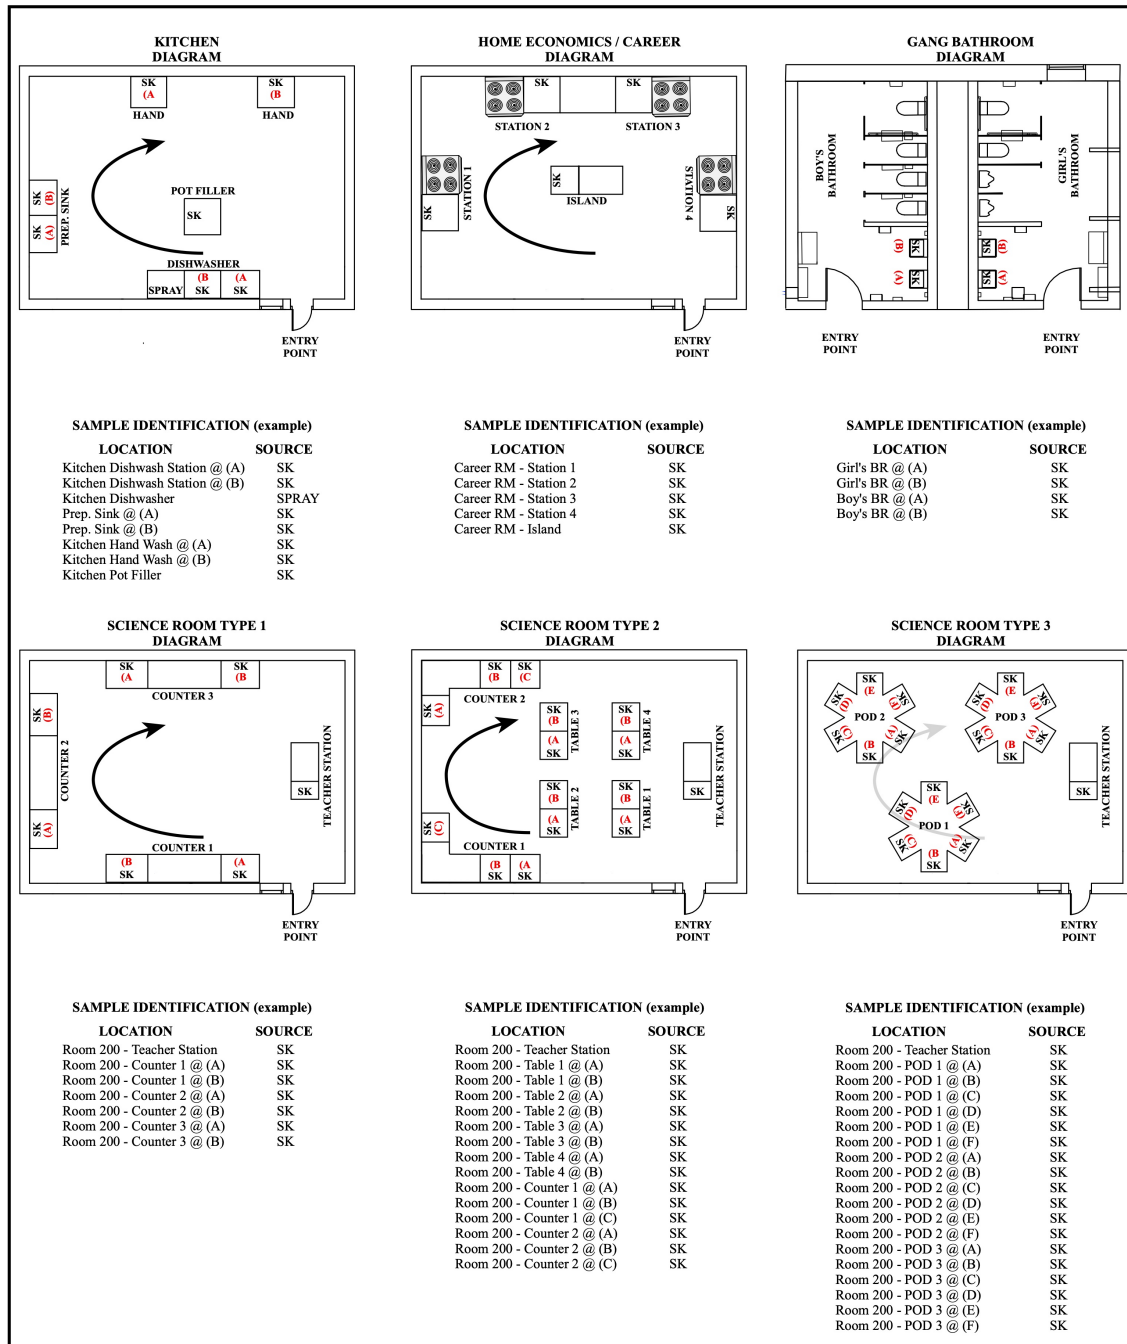

### III. Initial Results:

All water source locations in each of the school buildings were assessed. Water source locations identified as drinking water sources were considered Applicable, and first draw samples were collected. Water source locations identified as non-drinking water sources were considered Non-applicable and these locations were documented.

The results of the initial sampling and the use of signs warning against water use at Non-applicable sources is documented in the School Water Outlet Inventory for each building (Appendix A through F).

All elevated locations should be taken off line until the remediation is completed. Any other drinking water sources in these buildings that were not functional at the time of initial sampling and have not been tested should be tested. All locations deemed non-applicable, but do not have signs, should be taken off line until signs have been posted.

The following is a summary of results in parts per billion (ppb) of locations where sample results were found above 15 ppb:

#### Boyle Road Elementary School

Custodial Bathroom	SK	22.3
Room 101	WF	17.9
Room 104	WF	21.7
Room 106	WF	90.3
Nurse's Office	SK	21.7
Publishing Center	SK	22
Room K-2	WF	19.5
Room K-3	WF	23.7
Gym Office Bathroom	SK	86.3

#### Clinton Avenue Elementary School

Kitchen	PF	133
Kitchen 2-Bay @ B	SK	19.1
Men's Faculty Bathroom by A/V Room @ A	SK	48.8
Room 100	WF	35.2



## Norwood Avenue Elementary School

<b>No Exceedances</b>
-----------------------

## Terryville Road Elementary School

Kitchen Pot Filler	SP	18.9
Kitchen 3 Bay Prep	SPY	15.5
Faculty Bathroom by Cafeteria	SK	16.9
Art Room 200 Bathroom	SK	16.1
Part Time Staff Room Bathroom @ A	SK	15.9
Room 100A	SK	108
Room 104	WF	55.8
Room 105	WF	29.8
Room 106	SK	20.1

## John F. Kennedy Middle School

Faculty Bathroom by Gym - Left	SK	17.4
Faculty Bathroom by Gym - Right	SK	34.4
Girl's Coach's Office Bathroom	SK	21.7
Boy's Locker Room Bathroom - Left	SK	69.6
Boy's Locker Room Bathroom - Right	SK	16.9
Library Office	SK	53.2
Room 113 - Conference Room Bathroom	SK	15.2
Storage by Custodial Office	SK	31.4
Room 229 - Left	SK	19.5
Room 229 - Right	SK	15.8

## Comsewogue High School

Kitchen Pot Filler	PF	33.3
Room 128	SK	36.5
Lower Gym Boy's Locker Room	WF	43.6
Lower Gym Boy's Locker Room Bathroom Station @ A	SK	35.7
Lower Gym Boy's Locker Room Bathroom Station @ B	SK	20.3
Girl's Coach's Office Bathroom	SK	19.7
Lower Gym Girl's Locker Room	WF	41.6
Lower Gym Girl's Locker Room Bathroom @ A	SK	21.8
Lower Gym Girl's Locker Room Bathroom @ B	SK	42.2
Main Office	WF	42.9

## Appendix A

## Laboratory Report

NYE Report #: 2204257-15965

October 23, 2020

Project Manager  
Enviroscience Consultants, Inc.  
2150 Smithtown Avenue  
Ronkonkoma, NY 11779

Project: Boyle Road Elementary

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on October 21, 2020. New York Environmental analyzed the samples on October 22, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



---

Li Tsang, Laboratory Director

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen-3-Bay-Left	SK	App	2.11	10/21/2020	-	-	-	None	-	-	-
1001-2	Kitchen-3-Bay-Right	SK	App	3.23	10/21/2020	-	-	-	None	-	-	-
1001-3	Kitchen 3-Bay	SPY	App	3.54	10/21/2020	-	-	-	None	-	-	-
1001-4	Kitchen-Handwash by Dishwash	SK	N/A		10/21/2020	-	-	-	Sign Required	-	-	-
1001-5	Kitchen-Bathroom	SK	App	5.39	10/21/2020	-	-	-	None	-	-	-
1001-6	Kitchen-Handwash by Shelving	SK	N/A		10/21/2020	-	-	-	Sign Required	-	-	-
1001-7	Kitchen Island Prep by Freezer	SK	App	14.5	10/21/2020	-	-	-	None	-	-	-
1001-8	Kitchen Island Prep by Steamer	SK	App	1.32	10/21/2020	-	-	-	None	-	-	-
1002-1	Custodial Bathroom	SK	App	22.3	10/21/2020				Additional Sampling Required	Permanent Sign Posted		
1003-1	Cafeteria	WF	App		10/21/2020	-	-	-	None	Removed From Service	-	-
1004-1	Main Office Kitchenette	SK	App	6.49	10/21/2020	-	-	-	None	-	-	-
1005-1	Hallway by Main Office	WF	App		10/21/2020	-	-	-	None	Removed From Service	-	-
1005-2	Hallway by Main Office	BF	App	<1.0	10/21/2020	-	-	-	None	-	-	-
1006-1	Custodial Closet by Room 114	SS	N/A		10/21/2020	-	-	-	Sign Required	-	-	-
1007-1	Room 113	SK	App	6.94	10/21/2020	-	-	-	None	-	-	-
1007-2	Room 113	WF	App		10/21/2020	-	-	-	None	Removed From Service	-	-
1008-1	Room 111	SK	App	3.32	10/21/2020	-	-	-	None	-	-	-
1008-2	Room 111	WF	App		10/21/2020	-	-	-	None	Removed From Service	-	-
1009-1	Room 109	SK	App	3.51	10/21/2020	-	-	-	None	-	-	-
1009-2	Room 109	WF	App	2.45	10/21/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1010-1	Room 107	SK	App	7.06	10/21/2020	-	-	-	None	-	-	-
1010-2	Room 107	WF	App	9.03	10/21/2020	-	-	-	None	-	-	-
1011-1	Room 105	SK	App	2.41	10/21/2020	-	-	-	None	-	-	-
1011-2	Room 105	WF	App	8.73	10/21/2020	-	-	-	None	-	-	-
1012-1	Room 103	SK	App	4.73	10/21/2020	-	-	-	None	-	-	-
1012-2	Room 103	WF	App	5.55	10/21/2020	-	-	-	None	-	-	-
1013-1	Room 101	SK	App	2.51	10/21/2020	-	-	-	None	-	-	-
1013-2	Room 101	WF	App	17.9	10/21/2020				Additional Sampling Required	Fixture Replacement	13.6	12/4/2020
1014-1	Room 102	SK	App	1.59	10/21/2020	-	-	-	None	-	-	-
1014-2	Room 102	WF	App	12.8	10/21/2020	-	-	-	None	-	-	-
1015-1	Room 104	SK	App	5.99	10/21/2020	-	-	-	None	-	-	-
1015-2	Room 104	WF	App	21.7	10/21/2020				Additional Sampling Required	Fixture Replacement	13.9	12/4/2020
1016-1	Room 106	SK	App	11.2	10/21/2020	-	-	-	None	-	-	-
1016-2	Room 106	WF	App	90.3	10/21/2020				Additional Sampling Required	Fixture Replacement	<1.0	1/14/2021
1017-1	Room 108	SK	App	5.46	10/21/2020	-	-	-	None	-	-	-
1017-2	Room 108	WF	App	6.33	10/21/2020	-	-	-	None	-	-	-
1018-1	Room 110	SK	App	6.28	10/21/2020	-	-	-	None	-	-	-
1018-2	Room 110	WF	App		10/21/2020	-	-	-	None	Removed From Service	-	-
1019-1	Room 112	SK	App	12.7	10/21/2020	-	-	-	None	-	-	-
1019-2	Room 112	WF	App	2.87	10/21/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1020-1	Room 114	SK	App	7.84	10/21/2020	-	-	-	None	-	-	-
1020-2	Room 114	WF	App		10/21/2020	-	-	-	None	Removed From Service	-	-
1021-1	Nurse's Office	SK	App	21.7	10/21/2020				Additional Sampling Required	Water Cooler Provided		
1021-2	Nurse's Office Bathroom	SK	App		10/21/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1022-1	Faculty Men's Bathroom-Left	SK	App	6.57	10/21/2020	-	-	-	None	-	-	-
1022-2	Faculty Men's Bathroom-Right	SK	App	4.94	10/21/2020	-	-	-	None	-	-	-
1023-1	Hallway by Library	WF	App		10/21/2020	-	-	-	None	Removed From Service	-	-
1024-1	Faculty Women's Bathroom-Left	SK	App	<1.0	10/21/2020	-	-	-	None	-	-	-
1024-2	Faculty Women's Bathroom-Right	SK	App	<1.0	10/21/2020	-	-	-	None	-	-	-
1025-1	Publishing Center	SK	App	22	10/21/2020				Additional Sampling Required	Permanent Sign Posted		
1026-1	Room K-1	SK	App	3.87	10/21/2020	-	-	-	None	-	-	-
1026-2	Room K-1	WF	App		10/21/2020	-	-	-	None	Removed From Service	-	-
1027-1	Room K-2	SK	App	6.42	10/21/2020	-	-	-	None	-	-	-
1027-2	Room K-2	WF	App	19.5	10/21/2020				Additional Sampling Required	Fixture Replacement	9.4	12/4/2020
1028-1	Room K-3	SK	App	3.2	10/21/2020	-	-	-	None	-	-	-
1028-2	Room K-3	WF	App	23.7	10/21/2020				Additional Sampling Required	Fixture Replacement	<1.0	1/14/2020
1029-1	Custodial Closet by Faculty Room	SS	N/A		10/21/2020	-	-	-	Sign Required	-	-	-
1030-1	Faculty Room	SK	App	5.43	10/21/2020	-	-	-	None	-	-	-
1031-1	Hallway by Room 116	WF	App		10/21/2020	-	-	-	None	Removed From Service	-	-
1031-2	Hallway by Room 116	BF	App	<1.0	10/21/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1032-1	Boy's Bathroom by Room 116-Trough @A	SK	N/A		10/21/2020	-	-	-	Sign Required	-	-	-
1032-2	Boy's Bathroom by Room 116-Trough @B	SK	N/A		10/21/2020	-	-	-	Sign Required	-	-	-
1033-1	Girl's Bathroom by Room 116-Trough @A	SK	N/A		10/21/2020	-	-	-	Sign Required	-	-	-
1033-2	Girl's Bathroom by Room 116-Trough @B	SK	N/A		10/21/2020	-	-	-	Sign Required	-	-	-
1034-1	Custodial Closet by Room 115	SS	N/A		10/21/2020	-	-	-	Sign Required	-	-	-
1035-1	Room 115-Art-Left	SK	N/A		10/21/2020	-	-	-	Sign Required	-	-	-
1035-2	Room 115-Art-Right	SK	N/A		10/21/2020	-	-	-	Sign Required	-	-	-
1036-1	Gym Office Bathroom	SK	App	86.3	10/21/2020				Additional Sampling Required	Permanent Sign Posted		
1037-1	Gym-Recess Bathroom	SK	App	4.03	10/21/2020	-	-	-	None	-	-	-
1037-2	Gym-Recess Bathroom	WF	App		10/21/2020	-	-	-	None	Removed From Service	-	-
000-1	Boiler Room	SS	N/A		10/21/2020	-	-	-	Sign Required	-	-	-



Date Collected:	21 Oct 2020
Date Received:	21 Oct 2020
Date Analyzed:	22 Oct 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201021N059	1	Kitchen-3-Bay-Left-SK; Initial	1.00	2.11	µg/L	
201021N060	2	Kitchen-3-Bay-Right-SK; Initial	1.00	3.23	µg/L	
201021N061	3	Kitchen 3-Bay-SPY; Initial	1.00	3.54	µg/L	
201021N062	4	Kitchen Island Prep by Freezer-SK; Initial	1.00	14.5	µg/L	
201021N063	5	Kitchen Island Prep by Steamer-SK; Initial	1.00	1.32	µg/L	
201021N064	6	Custodial Bathroom-SK; Initial	1.00	22.3	µg/L	H
201021N065	7	Kitchen-Bathroom-SK; Initial	1.00	5.39	µg/L	
201021N066	8	Main Office Kitchenette-SK; Initial	1.00	6.49	µg/L	
201021N067	9	Hallway by Main Office-BF; Initial	1.00	<1.00	µg/L	
201021N068	10	Room 113-SK; Initial	1.00	6.94	µg/L	
201021N069	11	Room 111-SK; Initial	1.00	3.32	µg/L	
201021N070	12	Room 109-SK; Initial	1.00	3.51	µg/L	
201021N071	13	Room 109-WF; Initial	1.00	2.45	µg/L	
201021N072	14	Room 107-SK; Initial	1.00	7.06	µg/L	
201021N073	15	Room 107-WF; Initial	1.00	9.03	µg/L	
201021N074	16	Room 105-SK; Initial	1.00	2.41	µg/L	
201021N075	17	Room 105-WF; Initial	1.00	8.73	µg/L	
201021N076	18	Room 103-SK; Initial	1.00	4.73	µg/L	
201021N077	19	Room 103-WF; Initial	1.00	5.55	µg/L	
201021N078	20	Room 101-SK; Initial	1.00	2.51	µg/L	
201021N079	21	Room 101-WF; Initial	1.00	17.9	µg/L	H
201021N080	22	Room 102-SK; Initial	1.00	1.59	µg/L	
201021N081	23	Room 102-WF; Initial	1.00	12.8	µg/L	
201021N082	24	Room 104-SK; Initial	1.00	5.99	µg/L	
201021N083	25	Room 104-WF; Initial	1.00	21.7	µg/L	H
201021N084	26	Room 106-SK; Initial	1.00	11.2	µg/L	



Date Collected:	21 Oct 2020
Date Received:	21 Oct 2020
Date Analyzed:	22 Oct 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201021N085	27	Room 106-WF; Initial	1.00	90.3	µg/L	E,H
201021N086	28	Room 108-SK; Initial	1.00	5.46	µg/L	
201021N087	29	Room 108-WF; Initial	1.00	6.33	µg/L	
201021N088	30	Room 110-SK; Initial	1.00	6.28	µg/L	
201021N089	31	Room 112-SK; Initial	1.00	12.7	µg/L	
201021N090	32	Room 112-WF; Initial	1.00	2.87	µg/L	
201021N091	33	Room 114-SK; Initial	1.00	7.84	µg/L	
201021N092	34	Nurse's Office-SK; Initial	1.00	21.7	µg/L	H
201021N093	35	Faculty Men's Bathroom-Left-SK; Initial	1.00	6.57	µg/L	
201021N094	36	Faculty Men's Bathroom-Right-SK; Initial	1.00	4.94	µg/L	
201021N095	37	Faculty Women's Bathroom-Left-SK; Initial	1.00	<1.00	µg/L	
201021N096	38	Faculty Women's Bathroom-Right-SK; Initial	1.00	<1.00	µg/L	
201021N097	39	Publishing Center-SK; Initial	1.00	22.0	µg/L	H
201021N098	40	Room K-1-SK; Initial	1.00	3.87	µg/L	
201021N099	41	Room K-2-SK; Initial	1.00	6.42	µg/L	
201021N100	42	Room K-2-WF; Initial	1.00	19.5	µg/L	H
201021N101	43	Room K-3-SK; Initial	1.00	3.20	µg/L	
201021N102	44	Room K-3-WF; Initial	1.00	23.7	µg/L	H
201021N103	45	Faculty Room-SK; Initial	1.00	5.43	µg/L	
201021N104	46	Hallway by Room 116-BF; Initial	1.00	<1.00	µg/L	
201021N105	47	Gym Office Bathroom-SK; Initial	1.00	86.3	µg/L	E,H
201021N106	48	Gym-Recess Bathroom-WF; Initial	1.00	4.03	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.



**Laboratory Report**

NYE Report #: 2204858-16374

December 9, 2020

Project Manager  
Enviroscience Consultants, Inc.  
2150 Smithtown Avenue  
Ronkonkoma, NY 11779

Project: Boye Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on December 04, 2020. New York Environmental analyzed the samples on December 07, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



---

Li Tsang, Laboratory Director

Date Collected:	03 Dec 2020
Date Received:	04 Dec 2020
Date Analyzed:	07 Dec 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201204Q011	1	Rm 101-WF; Initial	1.00	13.6	µg/L	
201204Q012	2	Rm 104-WF; Initial	1.00	13.4	µg/L	
201204Q013	3	Rm 106-WF; Initial	1.00	84.1	µg/L	E,H
201204Q014	4	Rm K-3-WF; Initial	1.00	30.3	µg/L	H
201204Q015	5	Rm K-2-WF; Initial	1.00	9.40	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

## Laboratory Report

NYE Report #: 2210226-16709

January 17, 2021

Project Manager  
Enviroscience Consultants, Inc.  
2150 Smithtown Avenue  
Ronkonkoma, NY 11779

Project: Boyle Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on January 15, 2021. New York Environmental analyzed the samples on January 16, 2021 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



---

Li Tsang, Laboratory Director

Date Collected:	15 Jan 2021
Date Received:	15 Jan 2021
Date Analyzed:	16 Jan 2021

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

<u>Lab ID</u>	<u>CID</u>	<u>Sample Location/Description</u>	<u>LOQ</u>	<u>Result</u>	<u>Units</u>	<u>Flag</u>
210115Q066	1	Room 106-WF; Initial	1.00	<1.00	µg/L	
210115Q067	2	Room K3-WF; Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

## Appendix B

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Boiler Room	SS	N/A		10/21/2020	-	-	-	Sign Required	-	-	-
1002-1	Kitchen	PF	App	133	10/21/2020				Additional Sampling Required	Fixture Replacement	3.78	12/4/2020
1002-2	Kitchen 2-Bay @ A	SK	App	5.97	10/21/2020	-	-	-	None	-	-	-
1002-3	Kitchen 2-Bay @ B	SK	App	19.1	10/21/2020				Additional Sampling Required	Permanent Sign Posted		
1002-4	Kitchen by 2-Bay	SPY	App	4.47	10/21/2020	-	-	-	None	-	-	-
1002-5	Kitchen by Dishwash	SK	App	11.2	10/21/2020	-	-	-	None	-	-	-
1002-6	Kitchen by Dishwash	OS	N/A		10/21/2020	-	-	-	Sign Required	-	-	-
1002-7	Kitchen Island	SK	App	<1.0	10/21/2020	-	-	-	None	-	-	-
1002-8	Kitchen Bathroom by Boiler Room	SK	App	3.74	10/21/2020	-	-	-	None	-	-	-
1002-9	Kitchen Bathroom by Office	SK	App	9.41	10/21/2020	-	-	-	None	SIGN	-	-
1003-1	Cafeteria	WF	App	2.44	10/21/2020	-	-	-	None	-	-	-
1004-1	Boy's Locker Room Bathroom	WF	App		10/21/2020	-	-	-	None	Removed from Service	-	-
1004-2	Boy's Locker Room Bathroom	SK	App	<1.0	10/21/2020	-	-	-	None	-	-	-
1005-1	Girl's Locker Room Bathroom	WF	App	3.61	10/21/2020	-	-	-	None	-	-	-
1005-2	Girl's Locker Room Bathroom	SK	App	2.9	10/21/2020	-	-	-	None	-	-	-
1006-1	Hall by Vocal Music Room	WF	App	<1.0	10/21/2020	-	-	-	None	-	-	-
1006-2	Hall by Vocal Music Room	BF	App	<1.0	10/21/2020	-	-	-	None	-	-	-
1007-1	Boy's Bathroom by Art Room Unit @ A	SK	N/A		10/21/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1007-2	Boy's Bathroom by Art Room Unit @ B	SK	N/A		10/21/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1008-1	Girl's Bathroom by Art Room Unit @ A	SK	N/A		10/21/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1008-2	Girl's Bathroom by Art Room Unit @ B	SK	N/A		10/21/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1009-1	Custodial Closet by Art Room	SS	N/A		10/21/2020	-	-	-	Sign Required	-	-	-
1010-1	Art Room Unit @ A	SK	App		10/21/2020	-	-	-	Sign Required	-	-	-
1010-2	Art Room Unit @ B	SK	App		10/21/2020	-	-	-	Sign Required	-	-	-
1010-3	Art Room Unit @ C	SK	App		10/21/2020	-	-	-	Sign Required	-	-	-
1011-1	Faculty Room	SK	App	4.08	10/21/2020	-	-	-	None	-	-	-
1011-2	Faculty Room	SPY	App	8	10/21/2020	-	-	-	None	-	-	-
1012-1	Custodial Closet by Science Storage	SS	N/A		10/21/2020	-	-	-	Sign Required	-	-	-
1013-1	Room 003	WF	App	1.32	10/21/2020	-	-	-	None	-	-	-
1013-2	Room 003	SK	App	<1.0	10/21/2020	-	-	-	None	-	-	-
1014-1	Room 002	WF	App	<1.0	10/21/2020	-	-	-	None	-	-	-
1014-2	Room 002	SK	App	<1.0	10/21/2020	-	-	-	None	-	-	-
1015-1	Room 001	WF	App	2.94	10/21/2020	-	-	-	None	-	-	-
1015-2	Room 001	SK	App	<1.0	10/21/2020	-	-	-	None	-	-	-
1016-1	A/V Room	SK	App	10.7	10/21/2020	-	-	-	None	-	-	-
1017-1	Women's Faculty Bathroom by A/V Room @ A	SK	App	<1.0	10/21/2020	-	-	-	None	-	-	-
1017-2	Women's Faculty Bathroom by A/V Room @ B	SK	App	1.31	10/21/2020	-	-	-	None	-	-	-
1018-1	Hall by A/V Room	WF	App	2.12	10/21/2020	-	-	-	None	-	-	-
1019-1	Men's Faculty Bathroom by A/V Room @ A	SK	App	48.8	10/21/2020				Additional Sampling Required	Aerator Flushed	10.8	12/4/2020
1019-2	Men's Faculty Bathroom by A/V Room @ B	SK	App	4.57	10/21/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1020-1	Nurse's Office	SK	App	11.9	10/21/2020	-	-	-	None	-	-	-
1020-2	Nurse's Office Bathroom	SK	App	1.58	10/21/2020	-	-	-	None	-	-	-
1021-1	Copy Room	SK	App	1.29	10/21/2020	-	-	-	None	-	-	-
1022-1	Hall by Copy Room	WF	App	<1.0	10/21/2020	-	-	-	None	-	-	-
1022-2	Hall by Copy Room	BF	App	<1.0	10/21/2020	-	-	-	None	-	-	-
1023-1	Principal's Office Bathroom	SK	App	3.09	10/21/2020	-	-	-	None	-	-	-
1024-1	Custodial Closet by Room 101	SS	N/A		10/21/2020	-	-	-	Sign Required	-	-	-
1025-1	Room 100	WF	App	35.2	10/21/2020				Additional Sampling Required	Fixture cleaned	12.9	12/4/2020
1025-2	Room 100	SK	App	3.22	10/21/2020	-	-	-	None	-	-	-
1026-1	Room 101	WF	App	6.39	10/21/2020	-	-	-	None	-	-	-
1026-2	Room 101	SK	App	2.49	10/21/2020	-	-	-	None	-	-	-
1027-1	Room 102	WF	App	1.09	10/21/2020	-	-	-	None	-	-	-
1027-2	Room 102	SK	App	1.12	10/21/2020	-	-	-	None	-	-	-
1028-1	Room 103	WF	App	5.55	10/21/2020	-	-	-	None	-	-	-
1028-2	Room 103	SK	App	2.46	10/21/2020	-	-	-	None	-	-	-
1029-1	Room 104	WF	App	1.25	10/21/2020	-	-	-	None	-	-	-
1029-2	Room 104	SK	App	1.09	10/21/2020	-	-	-	None	-	-	-
1030-1	Room 105	WF	App	1.54	10/21/2020	-	-	-	None	-	-	-
1030-2	Room 105	SK	App	<1.0	10/21/2020	-	-	-	None	-	-	-
1031-1	Room 106	WF	App	3.28	10/21/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1031-2	Room 106	SK	App	<1.0	10/21/2020	-	-	-	None	-	-	-
1032-1	Room 107	WF	App	<1.0	10/21/2020	-	-	-	None	-	-	-
1032-2	Room 107	SK	App	<1.0	10/21/2020	-	-	-	None	-	-	-
1033-1	Room 108	WF	App	2.85	10/21/2020	-	-	-	None	-	-	-
1033-2	Room 108	SK	App	<1.0	10/21/2020	-	-	-	None	-	-	-
1034-1	Room 109	WF	App	<1.0	10/21/2020	-	-	-	None	-	-	-
1034-2	Room 109	SK	App	<1.0	10/21/2020	-	-	-	None	-	-	-
1035-1	Room 110	WF	App	<1.0	10/21/2020	-	-	-	None	-	-	-
1035-2	Room 110	SK	App	1	10/21/2020	-	-	-	None	-	-	-
1036-1	Room 111	WF	App	1.29	10/21/2020	-	-	-	None	-	-	-
1036-2	Room 111	SK	App	<1.0	10/21/2020	-	-	-	None	-	-	-

## Laboratory Report

NYE Report #: 2204256-15964

October 23, 2020

Project Manager  
Enviroscience Consultants, Inc.  
2150 Smithtown Avenue  
Ronkonkoma, NY 11779

Project: Clinton Ave Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on October 21, 2020. New York Environmental analyzed the samples on October 22, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



---

Li Tsang, Laboratory Director

Date Collected:	21 Oct 2020
Date Received:	21 Oct 2020
Date Analyzed:	22 Oct 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201021N001	1	Kitchen-PF; Initial	1.00	133	µg/L	E,H
201021N002	2	Kitchen 2-Bay @ A-SK; Initial	1.00	5.97	µg/L	
201021N003	3	Kitchen 2-Bay @ B-SK; Initial	1.00	19.1	µg/L	H
201021N004	4	Kitchen by 2-Bay-SPY; Initial	1.00	4.47	µg/L	
201021N005	5	Kitchen by Dishwash-SK; Initial	1.00	11.2	µg/L	
201021N006	6	Kitchen Island-SK; Initial	1.00	<1.00	µg/L	
201021N007	7	Kitchen Bathroom by Boiler Room-SK; Initial	1.00	3.74	µg/L	
201021N008	8	Kitchen Bathroom by Office-SK; Initial	1.00	9.41	µg/L	
201021N009	9	Cafeteria-WF; Initial	1.00	2.44	µg/L	
201021N010	10	Boy's Locker Room Bathroom-SK; Initial	1.00	<1.00	µg/L	
201021N011	11	Girl's Locker Room Bathroom-WF; Initial	1.00	3.61	µg/L	
201021N012	12	Girl's Locker Room Bathroom-SK; Initial	1.00	2.90	µg/L	
201021N013	13	Hall by Vocal Music Room-WF; Initial	1.00	<1.00	µg/L	
201021N014	14	Hall by Vocal Music Room-BF; Initial	1.00	<1.00	µg/L	
201021N015	15	Faculty Room-SK; Initial	1.00	4.08	µg/L	
201021N016	16	Faculty Room-SPY; Initial	1.00	8.00	µg/L	
201021N017	17	Room 003-WF; Initial	1.00	1.32	µg/L	
201021N018	18	Room 003-SK; Initial	1.00	<1.00	µg/L	
201021N019	19	Room 002-WF; Initial	1.00	<1.00	µg/L	
201021N020	20	Room 002-SK; Initial	1.00	<1.00	µg/L	
201021N021	21	Room 001-WF; Initial	1.00	2.94	µg/L	
201021N022	22	Room 001-SK; Initial	1.00	<1.00	µg/L	
201021N023	23	A/V Room-SK; Initial	1.00	10.7	µg/L	
201021N024	24	Women's Faculty Bathroom by A/V Room @ A-SK; Initial	1.00	<1.00	µg/L	
201021N025	25	Women's Faculty Bathroom by A/V Room @ B-SK; Initial	1.00	1.31	µg/L	
201021N026	26	Hall by A/V Room-WF; Initial	1.00	2.12	µg/L	

Date Collected:	21 Oct 2020
Date Received:	21 Oct 2020
Date Analyzed:	22 Oct 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201021N027	27	Men's Faculty Bathroom by A/V Room @ A-SK; Initial	1.00	48.8	µg/L	H
201021N028	28	Men's Faculty Bathroom by A/V Room @ B-SK; Initial	1.00	4.57	µg/L	
201021N029	29	Nurse's Office-SK; Initial	1.00	11.9	µg/L	
201021N030	30	Nurse's Office Bathroom-SK; Initial	1.00	1.58	µg/L	
201021N031	31	Copy Room-SK; Initial	1.00	1.29	µg/L	
201021N032	32	Hall by Copy Room-WF; Initial	1.00	<1.00	µg/L	
201021N033	33	Hall by Copy Room-BF; Initial	1.00	<1.00	µg/L	
201021N034	34	Principal's Office Bathroom-SK; Initial	1.00	3.09	µg/L	
201021N035	35	Room 100-WF; Initial	1.00	35.2	µg/L	H
201021N036	36	Room 100-SK; Initial	1.00	3.22	µg/L	
201021N037	37	Room 101-WF; Initial	1.00	6.39	µg/L	
201021N038	38	Room 101-SK; Initial	1.00	2.49	µg/L	
201021N039	39	Room 102-WF; Initial	1.00	1.09	µg/L	
201021N040	40	Room 102-SK; Initial	1.00	1.12	µg/L	
201021N041	41	Room 103-WF; Initial	1.00	5.55	µg/L	
201021N042	42	Room 103-SK; Initial	1.00	2.46	µg/L	
201021N043	43	Room 104-WF; Initial	1.00	1.25	µg/L	
201021N044	44	Room 104-SK; Initial	1.00	1.09	µg/L	
201021N045	45	Room 105-WF; Initial	1.00	1.54	µg/L	
201021N046	46	Room 105-SK; Initial	1.00	<1.00	µg/L	
201021N047	47	Room 106-WF; Initial	1.00	3.28	µg/L	
201021N048	48	Room 106-SK; Initial	1.00	<1.00	µg/L	
201021N049	49	Room 107-WF; Initial	1.00	<1.00	µg/L	
201021N050	50	Room 107-SK; Initial	1.00	<1.00	µg/L	
201021N051	51	Room 108-WF; Initial	1.00	2.85	µg/L	
201021N052	52	Room 108-SK; Initial	1.00	<1.00	µg/L	
201021N053	53	Room 109-WF; Initial	1.00	<1.00	µg/L	



Date Collected:	21 Oct 2020
Date Received:	21 Oct 2020
Date Analyzed:	22 Oct 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201021N054	54	Room 109-SK; Initial	1.00	<1.00	µg/L	
201021N055	55	Room 110-WF; Initial	1.00	<1.00	µg/L	
201021N056	56	Room 110-SK; Initial	1.00	1.00	µg/L	
201021N057	57	Room 111-WF; Initial	1.00	1.29	µg/L	
201021N058	58	Room 111-SK; Initial	1.00	<1.00	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

## Laboratory Report

NYE Report #: 2204857-16373

December 9, 2020

Project Manager  
Enviroscience Consultants, Inc.  
2150 Smithtown Avenue  
Ronkonkoma, NY 11779

Project: Clinton Ave Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on December 04, 2020. New York Environmental analyzed the samples on December 07, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



---

Li Tsang, Laboratory Director



Date Collected:	03 Dec 2020
Date Received:	04 Dec 2020
Date Analyzed:	07 Dec 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201204Q008	1	Room 100-WF; Initial	1.00	12.9	µg/L	
201204Q009	2	Men's Faculty Bathrm By A/V Rm @ A-SK; Initial	1.00	10.8	µg/L	
201204Q010	3	Kitchen-PF; Initial	1.00	3.78	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

## Appendix C

Space #	Sample Location	Fixture Type	App or N/A	Lastest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen-Handwash	SK	N/A		10/22/2010	-	-	-	Sign Required	-	-	-
1001-2	Kitchen Food Prep	SK	App	5.08	10/22/2010	-	-	-	None	-	-	-
1001-3	Kitchen Sanitizer Station @A	SK	App	1.22	10/22/2010	-	-	-	None	-	-	-
1001-4	Kitchen Sanitizer Station @A	SPY	App	1.45	10/22/2010	-	-	-	None	-	-	-
1001-5	Kitchen Sanitizer Station @B	SK	App	1.18	10/22/2010	-	-	-	None	-	-	-
1001-6	Kitchen Handwash by Serving Line	SK	N/A		10/22/2010	-	-	-	Sign Required	-	-	-
1001-7	Kitchen	SS	N/A		10/22/2010	-	-	-	Sign Required	-	-	-
1002-1	Kitchen Bathroom	SK	N/A		10/22/2010	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1003-1	Cafeteria	WF	App		10/22/2010	-	-	-	None	Removed From Service	-	-
1004-1	Art Room Unit @A	SK	N/A		10/22/2010	-	-	-	Sign Required	-	-	-
1004-2	Art Room Unit @B	SK	N/A		10/22/2010	-	-	-	Sign Required	-	-	-
1004-3	Art Room Unit @C	SK	N/A		10/22/2010	-	-	-	Sign Required	-	-	-
1005-1	Faculty Room	SK	App	2.11	10/22/2010	-	-	-	None	-	-	-
1006-1	Faculty Men's Bathroom by Gym	SK	App	<1.0	10/22/2010	-	-	-	None	-	-	-
1007-1	Faculty Women's Bathroom by Gym	SK	App	1.08	10/22/2010	-	-	-	None	-	-	-
1008-1	Hallway by Gym	WF	App		10/22/2010	-	-	-	None	Removed From Service	-	-
1008-2	Hallway by Gym	BF	App	<1.0	10/22/2010	-	-	-	None	-	-	-
1009-1	Boy's Bathroom by Gym	SK	App	<1.0	10/22/2010	-	-	-	None	-	-	-
1010-1	Girl's Bathroom by Gym	SK	App	1.89	10/22/2010	-	-	-	None	-	-	-
1011-1	Nurse's Office	SK	App		10/22/2010	-	-	-	None	Removed From Service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Lastest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1011-2	Nurse's Office Bathroom	SK	App	2.83	10/22/2010	-	-	-	None	-	-	-
1012-1	Main Office Kitchenette	SK	App	1.27	10/22/2010	-	-	-	None	-	-	-
1012-2	Main Office Kitchenette	SPY	App	1.18	10/22/2010	-	-	-	None	-	-	-
1012-3	Main Office Bathroom	SK	App	1.29	10/22/2010	-	-	-	None	-	-	-
1013-1	Room 105	WF	App	<1.0	10/22/2010	-	-	-	None	-	-	-
1013-2	Room 105	SK	App	1.25	10/22/2010	-	-	-	None	-	-	-
1014-1	Room 104	WF	App	2.9	10/22/2010	-	-	-	None	-	-	-
1014-2	Room 104	SK	App	<1.0	10/22/2010	-	-	-	None	-	-	-
1015-1	Room 103	WF	App	1.14	10/22/2010	-	-	-	None	-	-	-
1015-2	Room 103	SK	App	<1.0	10/22/2010	-	-	-	None	-	-	-
1016-1	Room 102	WF	App	1.96	10/22/2010	-	-	-	None	-	-	-
1016-2	Room 102	SK	App	<1.0	10/22/2010	-	-	-	None	-	-	-
1017-1	Room 101	WF	App	<1.0	10/22/2010	-	-	-	None	-	-	-
1017-2	Room 101	SK	App	<1.0	10/22/2010	-	-	-	None	-	-	-
1018-1	Room 100	WF	App	2.49	10/22/2010	-	-	-	None	-	-	-
1018-2	Room 100	SK	App	<1.0	10/22/2010	-	-	-	None	-	-	-
1019-1	Room K3	WF	App	<1.0	10/22/2010	-	-	-	None	-	-	-
1019-2	Room K3	SK	App	<1.0	10/22/2010	-	-	-	None	-	-	-
1020-1	Room K2	SK	App	<1.0	10/22/2010	-	-	-	None	-	-	-
1020-2	Room K2	WF	App	<1.0	10/22/2010	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Lastest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1021-1	Room K1	SK	App	1.31	10/22/2010	-	-	-	None	-	-	-
1021-2	Room K1	WF	App	<1.0	10/22/2010	-	-	-	None	-	-	-
1022-1	Custodian Closet by Room 107	SS	N/A		10/22/2010	-	-	-	Sign Required	-	-	-
1023-1	Hallway by Room 107 (Left)	WF	App		10/22/2010	-	-	-	None	Removed From Service	-	-
1023-2	Hallway by Room 107 (Right)	WF	App		10/22/2010	-	-	-	None	Removed From Service	-	-
1024-1	Room 107	SK	App	1.17	10/22/2010	-	-	-	None	-	-	-
1024-2	Room 107	SK	App	<1.0	10/22/2010	-	-	-	None	-	-	-
1025-1	Room 109	SK	App	2.71	10/22/2010	-	-	-	None	-	-	-
1025-2	Room 109	SK	App	<1.0	10/22/2010	-	-	-	None	-	-	-
1026-1	Room 106	SK	App	2.57	10/22/2010	-	-	-	None	-	-	-
1026-2	Room 106	SK	App	<1.0	10/22/2010	-	-	-	None	-	-	-
1027-1	District Administrator Kitchen	SK	App	14.6	10/22/2010	-	-	-	None	-	-	-
1028-1	Admin Building Lobby Men's Bathroom @A	SK	N/A		10/22/2010	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1028-2	Admin Building Lobby Men's Bathroom @B	SK	N/A		10/22/2010	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1029-1	Admin Building Lobby Women's Bathroom @A	SK	N/A		10/22/2010	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1029-2	Admin Building Lobby Women's Bathroom @B	SK	N/A		10/22/2010	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1030-1	Admin Building Copy Room/Kitchenette	SK	App	1.76	10/22/2010	-	-	-	None	-	-	-
1030-2	Admin Building Superintendent Office Bathroom	SK	App	12.4	10/22/2010	-	-	-	None	-	-	-
2001-1	Second Floor Girl's Bathroom Unit @A	SK	N/A		10/22/2010	-	-	-	None	SIGN	-	-
2001-2	Second Floor Girl's Bathroom Unit @B	SK	N/A		10/22/2010	-	-	-	None	SIGN	-	-

Space #	Sample Location	Fixture Type	App or N/A	Lastest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2001-3	Second Floor Girl's Bathroom Unit @C	SK	N/A		10/22/2010	-	-	-	None	SIGN	-	-
2002-1	Second Floor Boy's Bathroom Unit @A	SK	N/A		10/22/2010	-	-	-	Sign Required	-	-	-
2002-2	Second Floor Boy's Bathroom Unit @B	SK	N/A		10/22/2010	-	-	-	Sign Required	-	-	-
2002-3	Second Floor Boy's Bathroom Unit @C	SK	N/A		10/22/2010	-	-	-	Sign Required	-	-	-
2003-1	Second Floor Custodian Closet by Girl's Bathroom	SS	N/A		10/22/2010	-	-	-	None	SIGN	-	-
2004-1	Hallway by Room 207	WF	App		10/22/2010	-	-	-	None	Removed From Service	-	-
2004-2	Hallway by Room 207	BF	App	<1.0	10/22/2010	-	-	-	None	-	-	-
2005-1	Library Office	SK	App	5.38	10/22/2010	-	-	-	None	-	-	-
2006-1	Admin Building 2nd Fl Men's Bathroom @A	SK	App	6.64	10/22/2010	-	-	-	None	-	-	-
2006-2	Admin Building 2nd Fl Men's Bathroom @B	SK	App	1.84	10/22/2010	-	-	-	None	-	-	-
2007-1	Admin Building 2nd Fl Women's Bathroom @A	SK	App	8.91	10/22/2010	-	-	-	None	-	-	-
2007-2	Admin Building 2nd Fl Women's Bathroom @B	SK	App	1.4	10/22/2010	-	-	-	None	-	-	-
2008-1	Admin Building 2nd Fl Staff Room Kitchenette	SK	App	1.05	10/22/2010	-	-	-	None	-	-	-
2009-1	Admin 2nd Fl Hallway by Conference Room	WF	App		10/22/2010	-	-	-	None	Removed From Service	-	-
2009-2	Admin 2nd Fl Hallway by Conference Room	BF	App		10/22/2010	-	-	-	None	Removed From Service	-	-
2010-1	Admin 2nd Fl Assist. Superintendent Bathroom	SK	App	3.98	10/22/2010	-	-	-	None	-	-	-
2011-1	Admin 2nd Fl Associate Superintendent Bathroom	SK	App	5.12	10/22/2010	-	-	-	None	-	-	-

## Laboratory Report

NYE Report #: 2204265-15970

October 26, 2020

Project Manager  
Enviroscience Consultants, Inc.  
2150 Smithtown Avenue  
Ronkonkoma, NY 11779

Project: Norwood Avenue Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on October 22, 2020. New York Environmental analyzed the samples on October 23, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



---

Li Tsang, Laboratory Director

Date Collected:	22 Oct 2020
Date Received:	22 Oct 2020
Date Analyzed:	23 Oct 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201022P044	1	Kitchen Food Prep-SK; Initial	1.00	5.08	µg/L	
201022P045	2	Kitchen Sanitizer Station @A-SK; Initial	1.00	1.22	µg/L	
201022P046	3	Kitchen Sanitizer Station @A-SPY; Initial	1.00	1.45	µg/L	
201022P047	4	Kitchen Sanitizer Station @B-SK; Initial	1.00	1.18	µg/L	
201022P048	5	Faculty Room-SK; Initial	1.00	2.11	µg/L	
201022P049	6	Faculty Men's Bathroom by Gym-SK; Initial	1.00	<1.00	µg/L	
201022P050	7	Faculty Women's Bathroom by Gym-SK; Initial	1.00	1.08	µg/L	
201022P051	8	Hallway by Gym-BF; Initial	1.00	<1.00	µg/L	
201022P052	9	Boy's Bathroom by Gym-SK; Initial	1.00	<1.00	µg/L	
201022P053	10	Girl's Bathroom by Gym-SK; Initial	1.00	1.89	µg/L	
201022P054	11	Nurse's Office Bathroom-SK; Initial	1.00	2.83	µg/L	
201022P055	12	Main Office Kitchenette-SK; Initial	1.00	1.27	µg/L	
201022P056	13	Main Office Kitchenette-SPY; Initial	1.00	1.18	µg/L	
201022P057	14	Main Office Bathroom-SK; Initial	1.00	1.29	µg/L	
201022P058	15	Room 105-WF; Initial	1.00	<1.00	µg/L	
201022P059	16	Room 105-SK; Initial	1.00	1.25	µg/L	
201022P060	17	Room 104-WF; Initial	1.00	2.90	µg/L	
201022P061	18	Room 104-SK; Initial	1.00	<1.00	µg/L	
201022P062	19	Room 103-WF; Initial	1.00	1.14	µg/L	
201022P063	20	Room 103-SK; Initial	1.00	<1.00	µg/L	
201022P064	21	Room 102-WF; Initial	1.00	1.96	µg/L	
201022P065	22	Room 102-SK; Initial	1.00	<1.00	µg/L	
201022P066	23	Room 101-WF; Initial	1.00	<1.00	µg/L	
201022P067	24	Room 101-SK; Initial	1.00	<1.00	µg/L	
201022P068	25	Room 100-WF; Initial	1.00	2.49	µg/L	
201022P069	26	Room 100-SK; Initial	1.00	<1.00	µg/L	





Date Collected:	22 Oct 2020
Date Received:	22 Oct 2020
Date Analyzed:	23 Oct 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201022P070	27	Room K3-WF; Initial	1.00	<1.00	µg/L	
201022P071	28	Room K3-SK; Initial	1.00	<1.00	µg/L	
201022P072	29	Room K2-SK; Initial	1.00	<1.00	µg/L	
201022P073	30	Room K2-WF; Initial	1.00	<1.00	µg/L	
201022P074	31	Room K1-SK; Initial	1.00	1.31	µg/L	
201022P075	32	Room K1-WF; Initial	1.00	<1.00	µg/L	
201022P076	33	Room 107-SK; Initial	1.00	1.17	µg/L	
201022P077	34	Room 107-SK; Initial	1.00	<1.00	µg/L	
201022P078	35	Room 109-SK; Initial	1.00	2.71	µg/L	
201022P079	36	Room 109-SK; Initial	1.00	<1.00	µg/L	
201022P080	37	Room 106-SK; Initial	1.00	2.57	µg/L	
201022P081	38	Room 106-SK; Initial	1.00	<1.00	µg/L	
201022P082	39	District Administrator Kitchen-SK; Initial	1.00	14.6	µg/L	
201022P083	40	Admin Building Copy Room/Kitchenette-SK; Initial	1.00	1.76	µg/L	
201022P084	41	Admin Building Superintendent Office Bathroom-SK; Initial	1.00	12.4	µg/L	
201022P085	42	Hallway by Room 207-BF; Initial	1.00	<1.00	µg/L	
201022P086	43	Library Office-SK; Initial	1.00	5.38	µg/L	
201022P087	44	Admin Building 2nd Fl Men's Bathroom @A-SK; Initial	1.00	6.64	µg/L	
201022P088	45	Admin Building 2nd Fl Men's Bathroom @B-SK; Initial	1.00	1.84	µg/L	
201022P089	46	Admin Building 2nd Fl Women's Bathroom @A-SK; Initial	1.00	8.91	µg/L	
201022P090	47	Admin Building 2nd Fl Women's Bathroom @B-SK; Initial	1.00	1.40	µg/L	
201022P091	48	Admin Building 2nd Fl Staff Room Kitchenette-SK; Initial	1.00	1.05	µg/L	
201022P092	49	Admin 2nd Fl Assist. Superintendent Bathroom -SK; Initial	1.00	3.98	µg/L	
201022P093	50	Admin 2nd Fl Associate Superintendent Bathroom -SK; Initial	1.00	5.12	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation



## Appendix D

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen Office Handwash by Freezer	SK	N/A		10/22/2020	-	-	-	Sign Required	-	-	-
1001-2	Kitchen Island Fruit & Veggie Prep	SK	App	1.71	10/22/2020	-	-	-	None	-	-	-
1001-3	Kitchen Pot Filler	SP	App	18.9	10/22/2020				Additional Sampling Required	Fixture Replaced	3.31	12/4/2020
1001-4	Kitchen Island Handwash	SK	N/A		10/22/2020	-	-	-	Sign Required	-	-	-
1001-5	Kitchen 3 Bay Prep @ A	SK	App	2.21	10/22/2020	-	-	-	None	-	-	-
1001-6	Kitchen 3 Bay Prep @ B	SK	App	1.47	10/22/2020	-	-	-	None	-	-	-
1001-7	Kitchen 3 Bay Prep	SPY	App	15.5	10/22/2020				Additional Sampling Required	Permanent Sign Posted		
1002-1	Custodian Stock Room	SS	N/A		10/22/2020	-	-	-	None	SIGN	-	-
1003-1	Faculty Bathroom by Cafeteria	SK	App	16.9	10/22/2020				Additional Sampling Required	Permanent Sign Posted		
1004-1	Boys Bathroom by Room 200 @ A	SK	N/A		10/22/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1004-2	Boys Bathroom by Room 200 @ B	SK	N/A		10/22/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1004-3	Boys Bathroom by Room 200 @ C	SK	N/A		10/22/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1005-1	Custodial Closet by Room 200	SS	N/A		10/22/2020	-	-	-	None	SIGN	-	-
1006-1	Girls Bathroom by Room 200 @ A	SK	N/A		10/22/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1006-2	Girls Bathroom by Room 200 @ B	SK	N/A		10/22/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1006-3	Girls Bathroom by Room 200 @ C	SK	N/A		10/22/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1006-4	Girls Bathroom by Room 200 @ D	SK	N/A		10/22/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1007-1	Art Room 200 Unit by Front of Room @ A	SK	N/A		10/22/2020	-	-	-	Sign Required	-	-	-
1007-2	Art Room 200 Unit by Front of Room @ B	SK	N/A		10/22/2020	-	-	-	Sign Required	-	-	-
1007-3	Art Room 200 Unit by Back of Room @ A	SK	N/A		10/22/2020	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1007-4	Art Room 200 Unit by Back of Room @ B	SK	N/A		10/22/2020	-	-	-	Sign Required	-	-	-
1007-5	Art Room 200 Bathroom	SK	App	16.1	10/22/2020				Additional Sampling Required	Permanent Sign Posted		
1008-1	Room 201 Bathroom	SK	N/A		10/22/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1009-1	Hall by Room 206	WF	App		10/22/2020	-	-	-	None	Removed From Service	-	-
1009-2	Hall by Room 206	BF	App		10/22/2020	-	-	-	None	Removed From Service	-	-
1010-1	Part Time Staff Room Bathroom @ A	SK	App	15.9	10/22/2020				Additional Sampling Required	Permanent Sign Posted		
1010-2	Part Time Staff Room Bathroom @ B	SK	App	5.09	10/22/2020	-	-	-	None	-	-	-
1011-1	Hall by Cafeteria/Gym	WF	App		10/22/2020	-	-	-	None	Removed From Service	-	-
1012-1	Gym Storage Bathroom @ A	SK	App	12.8	10/22/2020	-	-	-	None	-	-	-
1012-2	Gym Storage Bathroom @ B	SK	App	5.96	10/22/2020	-	-	-	None	-	-	-
1013-1	Orchestra/Speech Language Room	SK	App	8.44	10/22/2020	-	-	-	None	-	-	-
1014-1	Girls Bathroom by Gym @ A	SK	N/A		10/22/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1014-2	Girls Bathroom by Gym @ B	SK	N/A		10/22/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1015-1	Boys Bathroom by Gym @ A	SK	N/A		10/22/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1015-2	Boys Bathroom by Gym @ B	SK	N/A		10/22/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1016-1	Faculty Bathroom (Right)	SK	App	1.47	10/22/2020	-	-	-	None	-	-	-
1017-1	Faculty Bathroom (Left)	SK	App	<1.0	10/22/2020	-	-	-	None	-	-	-
1018-1	Hall by Room 302	WF	App		10/22/2020	-	-	-	None	Removed From Service	-	-
1019-1	Custodial Closet by Room 302	SS	N/A		10/22/2020	-	-	-	None	SIGN	-	-
1020-1	Faculty Room Kitchenette	SK	App	3.64	10/22/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1021-1	Media Center Office	SK	App	7.22	10/22/2020	-	-	-	None	-	-	-
1022-1	Hall by Main Office	WF	App		10/22/2020	-	-	-	None	Removed From Service	-	-
1022-2	Hall by Main Office	BF	App	<1.0	10/22/2020	-	-	-	None	-	-	-
1023-1	Nurses Office Bathroom	SK	App	3.59	10/22/2020	-	-	-	None	-	-	-
1023-2	Nurses Office	SK	App	<1.0	10/22/2020	-	-	-	None	-	-	-
1024-1	Room 100 Bathroom	SK	App	2.73	10/22/2020	-	-	-	None	-	-	-
1024-2	Room 100	SK	App	<1.0	10/22/2020	-	-	-	None	-	-	-
1025-1	Room 100A	SK	App	108	10/22/2020				Additional Sampling Required	Permanent Sign Posted		
1026-1	Room 102 Bathroom	SK	App	7.87	10/22/2020	-	-	-	None	-	-	-
1026-2	Room 102	WF	App		10/22/2020	-	-	-	None	Removed From Service	-	-
1027-1	Technology Office Bathroom	SK	App	11.3	10/22/2020	-	-	-	None	-	-	-
1028-1	Room 104 Bathroom	SK	App	8.51	10/22/2020	-	-	-	None	-	-	-
1028-2	Room 104	WF	App	55.8	10/22/2020				Additional Sampling Required	Capped		
1029-1	Room 105 Bathroom	SK	App	3.93	10/22/2020	-	-	-	None	-	-	-
1029-2	Room 105	WF	App	29.8	10/22/2020				Additional Sampling Required	Fixture Replaced	14.4	12/4/2020
1030-1	Room 106 Bathroom	SK	App	2.15	10/22/2020	-	-	-	None	-	-	-
1030-2	Room 106	SK	App	20.1	10/22/2020				Additional Sampling Required	Permanent Sign Posted		
1031-1	Room 107 Bathroom	SK	App	6.93	10/22/2020	-	-	-	None	-	-	-
1031-2	Room 107	SK	App	7.1	10/22/2020	-	-	-	None	-	-	-
1032-1	Room 108 Bathroom	SK	App	5.26	10/22/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1032-2	Room 108	WF	App		10/22/2020	-	-	-	None	Removed From Service	-	-
1033-1	Room 109 Bathroom	SK	App	4.36	10/22/2020	-	-	-	None	-	-	-
1034-1	Room 110 Bathroom	SK	App	2.29	10/22/2020	-	-	-	None	-	-	-
1034-2	Room 110	SK	App		10/22/2020	-	-	-	None	Removed From Service	-	-
1035-1	Room 111 Bathroom	SK	App	5.48	10/22/2020	-	-	-	None	-	-	-
1035-2	Room 111	SK	App	2.64	10/22/2020	-	-	-	None	-	-	-
1036-1	Custodial Closet by Room 111	SS	N/A		10/22/2020	-	-	-	None	SIGN	-	-
1037-1	Hall by Room 111	WF	App	1.63	10/22/2020	-	-	-	None	-	-	-
1038-1	Room 001 Bathroom	SK	App	5.5	10/22/2020	-	-	-	None	-	-	-
1038-2	Room 001	SK	App	<1.0	10/22/2020	-	-	-	None	-	-	-
1039-1	Room 002 Bathroom	SK	App	8.6	10/22/2020	-	-	-	None	-	-	-
1039-2	Room 002	SK	App		10/22/2020	-	-	-	None	Removed From Service	-	-
1040-1	Room 003 Bathroom	SK	App	4.6	10/22/2020	-	-	-	None	-	-	-
1040-2	Room 003	SK	App		10/22/2020	-	-	-	None	Removed From Service	-	-

**Laboratory Report**

NYE Report #: 2204264-15969

October 26, 2020

Project Manager  
Enviroscience Consultants, Inc.  
2150 Smithtown Avenue  
Ronkonkoma, NY 11779

Project: Terryville Road Elementary School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on October 22, 2020. New York Environmental analyzed the samples on October 23, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



---

Li Tsang, Laboratory Director

Date Collected:	22 Oct 2020
Date Received:	22 Oct 2020
Date Analyzed:	23 Oct 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201022P002	1	Kitchen Island Fruit & Veggie Prep-SK; Initial	1.00	1.71	µg/L	
201022P003	2	Kitchen Pot Filler-SP; Initial	1.00	18.9	µg/L	H
201022P004	3	Kitchen 3 Bay Prep @ A-SK; Initial	1.00	2.21	µg/L	
201022P005	4	Kitchen 3 Bay Prep @ B-SK; Initial	1.00	1.47	µg/L	
201022P006	5	Kitchen 3 Bay Prep-SPY; Initial	1.00	15.5	µg/L	H
201022P007	6	Faculty Bathroom by Cafeteria- SK; Initial	1.00	16.9	µg/L	H
201022P008	7	Art Room 200 Bathroom-SK; Initial	1.00	16.1	µg/L	H
201022P009	8	Part Time Staff Room Bathroom @ A-SK; Initial	1.00	15.9	µg/L	H
201022P010	9	Part Time Staff Room Bathroom @ B-SK; Initial	1.00	5.09	µg/L	
201022P011	10	Gym Storage Bathroom @ A-SK; Initial	1.00	12.8	µg/L	
201022P012	11	Gym Storage Bathroom @ B-SK; Initial	1.00	5.96	µg/L	
201022P013	12	Orchestra/Speech Language Room-SK; Initial	1.00	8.44	µg/L	
201022P014	13	Faculty Bathroom (Right)-SK; Initial	1.00	1.47	µg/L	
201022P015	14	Faculty Bathroom (Left)-SK; Initial	1.00	<1.00	µg/L	
201022P016	15	Faculty Room Kitchenette-SK; Initial	1.00	3.64	µg/L	
201022P017	16	Media Center Office-SK; Initial	1.00	7.22	µg/L	
201022P018	17	Hall by Main Office Bottle Filler-BF; Initial	1.00	<1.00	µg/L	
201022P019	18	Nurses Office Bathroom-SK; Initial	1.00	3.59	µg/L	
201022P020	19	Nurses Office-SK; Initial	1.00	<1.00	µg/L	
201022P021	20	Room 100 Bathroom-SK; Initial	1.00	2.73	µg/L	
201022P022	21	Room 100-SK; Initial	1.00	<1.00	µg/L	
201022P023	22	Room 100A-SK; Initial	1.00	108	µg/L	E,H
201022P024	23	Room 102 Bathroom-SK; Initial	1.00	7.87	µg/L	
201022P025	24	Technology Office Bathroom-SK; Initial	1.00	11.3	µg/L	
201022P026	25	Room 104 Bathroom-SK; Initial	1.00	8.51	µg/L	
201022P027	26	Room 104-WF; Initial	1.00	55.8	µg/L	E,H





Date Collected:	22 Oct 2020
Date Received:	22 Oct 2020
Date Analyzed:	23 Oct 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201022P028	27	Room 105 Bathroom-SK; Initial	1.00	3.93	µg/L	
201022P029	28	Room 105-WF; Initial	1.00	29.8	µg/L	H
201022P030	29	Room 106 Bathroom-SK; Initial	1.00	2.15	µg/L	
201022P031	30	Room 106-SK; Initial	1.00	20.1	µg/L	H
201022P032	31	Room 107 Bathroom-SK; Initial	1.00	6.93	µg/L	
201022P033	32	Room 107-SK; Initial	1.00	7.10	µg/L	
201022P034	33	Room 108 Bathroom-SK; Initial	1.00	5.26	µg/L	
201022P035	34	Room 109 Bathroom-SK; Initial	1.00	4.36	µg/L	
201022P036	35	Room 110 Bathroom-SK; Initial	1.00	2.29	µg/L	
201022P037	36	Room 111 Bathroom-SK; Initial	1.00	5.48	µg/L	
201022P038	37	Room 111-SK; Initial	1.00	2.64	µg/L	
201022P039	38	Hall by Room 111-WF; Initial	1.00	1.63	µg/L	
201022P040	39	Room 001 Bathroom-SK; Initial	1.00	5.50	µg/L	
201022P041	40	Room 001-SK; Initial	1.00	<1.00	µg/L	
201022P042	41	Room 002 Bathroom-SK; Initial	1.00	8.60	µg/L	
201022P043	42	Room 003 Bathroom-SK; Initial	1.00	4.60	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.



## Laboratory Report

NYE Report #: 2204856-16372

December 9, 2020

Project Manager  
Enviroscience Consultants, Inc.  
2150 Smithtown Avenue  
Ronkonkoma, NY 11779

Project: Terryville Elementary School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on December 04, 2020. New York Environmental analyzed the samples on December 07, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



---

Li Tsang, Laboratory Director

Date Collected:	03 Dec 2020
Date Received:	04 Dec 2020
Date Analyzed:	07 Dec 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201204Q006	1	Kitchen Pot Filler-SK; Initial	1.00	3.31	µg/L	
201204Q007	2	Rm 105-WF; Initial	1.00	14.4	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

## Appendix E

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1 <sup>st</sup> Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen Serving Area - Handwash	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1001-2	Kitchen 3-Bay Dishwash - Left	SK	App	<1.0	10/20/2020	-	-	-	None	-	-	-
1001-3	Kitchen 3-Bay Dishwash - Right	SK	App	5.69	10/20/2020	-	-	-	None	-	-	-
1001-4	Kitchen 3-Bay Dishwash	SPY	App	<1.0	10/20/2020	-	-	-	None	-	-	-
1001-5	Kitchen Prep Single Sink	SPY	App	7.48	10/20/2020	-	-	-	None	-	-	-
1001-6	Kitchen Prep Single Sink	SK	App	3.7	10/20/2020	-	-	-	None	-	-	-
1001-7	Kitchen Custodial Closet	SS	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1001-8	Kitchen Bathroom - Left	SK	App	13	10/20/2020	-	-	-	None	-	-	-
1001-9	Kitchen Bathroom - Right	SK	App	11.2	10/20/2020	-	-	-	None	-	-	-
1001-10	Kitchen Handwash	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1001-11	Kitchen Custodial Closet	SS	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1001-12	Kitchen Pot Filler	PF	App	2.02	10/20/2020	-	-	-	None	-	-	-
1001-13	Kitchen Prep Island - Handwash	SK	N/A		10/20/2020	-	-	-	None	SIGN	-	-
1002-1	Faculty Bathroom by Gym - Left	SK	App	17.4	10/20/2020				Additional Sampling Required	Permanent Sign Posted		
1002-2	Faculty Bathroom by Gym - Right	SK	App	34.4	10/20/2020				Additional Sampling Required	Permanent Sign Posted		
1003-1	Hallway by Gym	WF	App		10/20/2020	-	-	-	None	Removed From Service	-	-
1003-2	Hallway by Gym	BF	App	<1.0	10/20/2020	-	-	-	None	-	-	-
1004-1	Hallway by Gym - Porcelain	WF	App		10/20/2020	-	-	-	None	Removed From Service	-	-
1005-1	Girl's Coach's Office Bathroom	SK	App	21.7	10/20/2020				Additional Sampling Required	Permanent Sign Posted		
1006-1	Girl's Locker Room Bathroom @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1006-2	Girl's Locker Room Bathroom @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1 <sup>st</sup> Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1006-3	Girl's Locker Room	WF	App	3.48	10/20/2020	-	-	-	None	-	-	-
1007-1	Boy's Coach's Office Bathroom	SK	App	10.9	10/20/2020	-	-	-	None	-	-	-
1007-2	Boy's Locker Room Bathroom - Left	SK	App	69.6	10/20/2020				Additional Sampling Required	Permanent Sign Posted		
1007-3	Boy's Locker Room Bathroom - Right	SK	App	16.9	10/20/2020				Additional Sampling Required	Permanent Sign Posted		
1007-4	Boy's Locker Room	WF	App		10/20/2020	-	-	-	None	Removed From Service	-	-
1008-1	Ice Machine Room	IM	App	<1.0	10/20/2020	-	-	-	None	-	-	-
1009-1	Faculty Room by Cafeteria	SK	App	2.17	10/20/2020	-	-	-	None	-	-	-
1009-2	Faculty Room by Cafeteria - Filtered	SK	App	<1.0	10/20/2020	-	-	-	None	-	-	-
1010-1	Cafeteria By Faculty Room	WF	App		10/20/2020	-	-	-	Removed From Service	-	-	-
1010-2	Cafeteria By Faculty Room	BF	App	<1.0	10/20/2020	-	-	-	None	-	-	-
1011-1	Cafeteria By Custodial Office	WF	App		10/20/2020	-	-	-	Removed From Service	-	-	-
1012-1	Women's Bathroom by Cafeteria	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1013-1	Men's Bathroom by Cafeteria	SK	App	1.73	10/20/2020	-	-	-	None	-	-	-
1014-1	Room 108 Home Economics @ A	SK	App	6.27	10/20/2020	-	-	-	None	-	-	-
1014-2	Room 108 Home Economics @ B	SK	App	2.44	10/20/2020	-	-	-	None	-	-	-
1014-3	Room 108 Home Economics @ C	SK	App	8.41	10/20/2020	-	-	-	None	-	-	-
1015-1	Girl's Bathroom by Room 107 Trough @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1015-2	Girl's Bathroom by Room 107 Trough @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1015-3	Girl's Bathroom by Room 107 Trough @ C	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1015-4	Girl's Bathroom by Room 107 Trough @ D	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1016-1	Custodial Closet by Room 107	SS	N/A		10/20/2020	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1 <sup>st</sup> Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1017-1	Boy's Bathroom by Room 107 Trough 1 @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1017-2	Boy's Bathroom by Room 107 Trough 1 @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1017-3	Boy's Bathroom by Room 107 Trough 1 @ C	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1017-4	Boy's Bathroom by Room 107 Trough 2 @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1017-5	Boy's Bathroom by Room 107 Trough 2 @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1017-6	Boy's Bathroom by Room 107 Trough 2 @ C	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1018-1	Room 106 Home Economics @ A	SK	App	3.63	10/20/2020	-	-	-	None	-	-	-
1018-2	Room 106 Home Economics @ B	SK	App	1.1	10/20/2020	-	-	-	None	-	-	-
1018-3	Room 106 Home Economics @ C	SK	App	<1.0	10/20/2020	-	-	-	None	-	-	-
1019-1	Main Office Bathroom	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1019-2	Main Office	WF	App		10/20/2020	-	-	-	Removed From Service	-	-	-
1019-3	Main Office	BF	App		10/20/2020	-	-	-	Removed From Service	-	-	-
1020-1	Library Office	SK	App	53.2	10/20/2020				Additional Sampling Required	Permanent Sign Posted		
1021-1	Nurse's Office	SK	App	5.63	10/20/2020	-	-	-	None	-	-	-
1021-2	Nurse's Office Bathroom	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1022-1	Hallway by Nurse's Office	WF	App		10/20/2020	-	-	-	Removed From Service	-	-	-
1022-2	Hallway by Nurse's Office	BF	App	<1.0	10/20/2020	-	-	-	None	-	-	-
1023-1	Room 113 - Conference Room Bathroom	SK	App	15.2	10/20/2020				Additional Sampling Required	Permanent Sign Posted		
1024-1	Girl's Bathroom by Room 114 Trough @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1024-2	Girl's Bathroom by Room 114 Trough @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1024-3	Girl's Bathroom by Room 114 Trough @ C	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1 <sup>st</sup> Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1024-4	Girl's Bathroom by Room 114 Trough @ D	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1025-1	Custodial Closet by Room 114	SS	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1026-1	Boy's Bathroom by Room 114 Trough 1 @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1026-2	Boy's Bathroom by Room 114 Trough 1 @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1026-3	Boy's Bathroom by Room 114 Trough 1 @ C	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1026-4	Boy's Bathroom by Room 114 Trough 2 @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1026-5	Boy's Bathroom by Room 114 Trough 2 @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1026-6	Boy's Bathroom by Room 114 Trough 2 @ C	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1027-1	Room 111 Art @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1027-2	Room 111 Art @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1028-1	Room 110 Art @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1028-2	Room 110 Art @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1029-1	Storage by Custodial Office	SK	App	31.4	10/20/2020				Additional Sampling Required	Permanent Sign Posted		
2001-1	Hallway by Room 201	WF	App		10/20/2020	-	-	-	Removed From Service	-	-	-
2001-2	Hallway by Room 201	BF	App	<1.0	10/20/2020	-	-	-	None	-	-	-
2002-1	Boy's Bathroom by Room 211 Trough 1 @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2002-2	Boy's Bathroom by Room 211 Trough 1 @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2002-3	Boy's Bathroom by Room 211 Trough 1 @ C	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2002-4	Boy's Bathroom by Room 211 Trough 2 @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2002-5	Boy's Bathroom by Room 211 Trough 2 @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2002-6	Boy's Bathroom by Room 211 Trough 2 @ C	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1 <sup>st</sup> Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2003-1	Custodial Closet by Room 211	SS	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2004-1	Girl's Bathroom by Room 211 Trough @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2004-2	Girl's Bathroom by Room 211 Trough @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2004-3	Girl's Bathroom by Room 211 Trough @ C	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2004-4	Girl's Bathroom by Room 211 Trough @ D	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2005-1	Room 211 Teacher's Station	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2005-2	Room 211 Counter @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2005-3	Room 211 Counter @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2005-4	Room 211 Counter @ C	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2005-5	Room 211 Counter @ D	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2005-6	Room 211 Counter @E	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2006-1	Room 212 Teacher's Station	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2006-2	Room 212 Counter @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2006-3	Room 212 Counter @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2006-4	Room 212 Counter @ C	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2006-5	Room 212 Counter @ D	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2006-6	Room 212 Counter @E	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2007-1	Room 213 Teacher's Station	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2007-2	Room 213 Counter @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2007-3	Room 213 Counter @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2007-4	Room 213 Counter @ C	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1 <sup>st</sup> Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2008-1	Hallway by Room 214	WF	App		10/20/2020	-	-	-	Removed From Service	-	-	-
2008-2	Hallway by Room 214	BF	App		10/20/2020	-	-	-	Removed From Service	-	-	-
2009-1	Room 214 Teacher's Station	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2009-2	Room 214 Counter @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2009-3	Room 214 Counter @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2009-4	Room 214 Counter @ C	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2009-5	Room 214 Counter @ D	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2010-1	Room 215 Teacher's Station	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2010-2	Room 215 Counter @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2010-3	Room 215 Counter @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2010-4	Room 215 Counter @ C	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2010-5	Room 215 Counter @ D	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2010-6	Room 215 Counter @E	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2010-7	Room 215 Counter @F	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2011-1	Chemical Storage by Room 216	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-1	Room 216 Teacher's Station	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-2	Room 216-Pod 1 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-3	Room 216-Pod 1 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-4	Room 216-Pod 2 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-5	Room 216-Pod 2 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-6	Room 216-Pod 2 @ C	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1 <sup>st</sup> Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2012-7	Room 216-Pod 2 @ D	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-8	Room 216-Pod 3 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-9	Room 216-Pod 3 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-10	Room 216-Pod 4 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-11	Room 216-Pod 4 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-12	Room 216-Pod 5 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-13	Room 216-Pod 5 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-14	Room 216-Pod 6 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-15	Room 216-Pod 6 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-16	Room 216 Counter	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2013-1	Room 231 @ A (Closer to Door)	SK	App	5.54	10/20/2020	-	-	-	None	-	-	-
2013-2	Room 231 @B	SK	App	7.55	10/20/2020	-	-	-	None	-	-	-
2014-1	Science Storage by Room 217	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2015-1	Room 217 Teacher's Station	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2016-1	Hallway by Room 220	WF	App		10/20/2020	-	-	-	Removed From Service	-	-	-
2016-2	Hallway by Room 220	BF	App	<1.0	10/20/2020	-	-	-	None	-	-	-
2017-1	Unisex Handicap Faculty Bathroom	SK	App	2.5	10/20/2020	-	-	-	None	-	-	-
2018-1	Faculty Bathroom	SK	App	2.32	10/20/2020	-	-	-	None	-	-	-
2019-1	Boy's Bathroom by Room 225 Trough 1 @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2019-2	Boy's Bathroom by Room 225 Trough 1 @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2019-3	Boy's Bathroom by Room 225 Trough 1 @ C	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2019-4	Boy's Bathroom by Room 225 Trough 2 @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2019-5	Boy's Bathroom by Room 225 Trough 2 @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2019-6	Boy's Bathroom by Room 225 Trough 2 @ C	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2020-1	Custodial Closet by Room 225	SS	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2021-1	Girl's Bathroom by Room 225 Trough 1 @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2021-2	Girl's Bathroom by Room 225 Trough 1 @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2021-3	Girl's Bathroom by Room 225 Trough 1 @ C	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2021-4	Girl's Bathroom by Room 225 Trough 2 @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2021-5	Girl's Bathroom by Room 225 Trough 2 @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2021-6	Girl's Bathroom by Room 225 Trough 2 @ C	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2022-1	Room 230	SS	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2023-1	Room 229 - Left	SK	App	19.5	10/20/2020				Additional Sampling Required	Permanent Sign Posted		
2023-2	Room 229 - Right	SK	App	15.8	10/20/2020				Additional Sampling Required	Permanent Sign Posted		

## Laboratory Report

NYE Report #: 2204238-15959

October 22, 2020

Project Manager  
Enviroscience Consultants, Inc.  
2150 Smithtown Avenue  
Ronkonkoma, NY 11779

Project: John F. Kennedy Middle School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on October 20, 2020. New York Environmental analyzed the samples on October 21, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



---

Li Tsang, Laboratory Director

Date Collected:	20 Oct 2020
Date Received:	20 Oct 2020
Date Analyzed:	21 Oct 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201020Q001	1	Kitchen 3-Bay Dishwash - Left-SK; Initial	1.00	<1.00	µg/L	
201020Q002	2	Kitchen 3-Bay Dishwash - Right-SK; Initial	1.00	5.69	µg/L	
201020Q003	3	Kitchen 3-Bay Dishwash-SPY; Initial	1.00	<1.00	µg/L	
201020Q004	4	Kitchen Prep Single Sink-SPY; Initial	1.00	7.48	µg/L	
201020Q005	5	Kitchen Prep Single Sink-SK; Initial	1.00	3.70	µg/L	
201020Q006	6	Kitchen Bathroom - Left-SK; Initial	1.00	13.0	µg/L	
201020Q007	7	Kitchen Bathroom - Right-SK; Initial	1.00	11.2	µg/L	
201020Q008	8	Kitchen Pot Filler-PF; Initial	1.00	2.02	µg/L	
201020Q009	9	Faculty Bathroom by Gym - Left-SK; Initial	1.00	17.4	µg/L	H
201020Q010	10	Faculty Bathroom by Gym - Right-SK; Initial	1.00	34.4	µg/L	H
201020Q011	11	Hallway by Gym-BF; Initial	1.00	<1.00	µg/L	
201020Q012	12	Girl's Coach's Office Bathroom-SK; Initial	1.00	21.7	µg/L	H
201020Q013	13	Girl's Locker Room-WF; Initial	1.00	3.48	µg/L	
201020Q014	14	Boy's Coach's Office Bathroom-SK; Initial	1.00	10.9	µg/L	
201020Q015	15	Boy's Locker Room Bathroom - Left-SK; Initial	1.00	69.6	µg/L	E,H
201020Q016	16	Boy's Locker Room Bathroom - Right-SK; Initial	1.00	16.9	µg/L	H
201020Q017	17	Ice Machine Room-IM; Initial	1.00	<1.00	µg/L	
201020Q018	18	Faculty Room by Cafeteria-SK; Initial	1.00	2.17	µg/L	
201020Q019	19	Faculty Room by Cafeteria - Filtered-SK; Initial	1.00	<1.00	µg/L	
201020Q020	20	Cafeteria By Faculty Room-BF; Initial	1.00	<1.00	µg/L	
201020Q021	21	Men's Bathroom by Cafeteria-SK; Initial	1.00	1.73	µg/L	
201020Q022	22	Room 108 Home Economics @ A-SK; Initial	1.00	6.27	µg/L	
201020Q023	23	Room 108 Home Economics @ B-SK; Initial	1.00	2.44	µg/L	
201020Q024	24	Room 108 Home Economics @ C-SK; Initial	1.00	8.41	µg/L	
201020Q025	25	Room 106 Home Economics @ A-SK; Initial	1.00	3.63	µg/L	
201020Q026	26	Room 106 Home Economics @ B-SK; Initial	1.00	1.10	µg/L	

Date Collected:	20 Oct 2020
Date Received:	20 Oct 2020
Date Analyzed:	21 Oct 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201020Q027	27	Room 106 Home Economics @ C-SK; Initial	1.00	<1.00	µg/L	
201020Q028	28	Library Office-SK; Initial	1.00	53.2	µg/L	E,H
201020Q029	29	Nurse's Office-SK; Initial	1.00	5.63	µg/L	
201020Q030	30	Hallway by Nurse's Office-BF; Initial	1.00	<1.00	µg/L	
201020Q031	31	Room 113 - Conference Room Bathroom-SK; Initial	1.00	15.2	µg/L	H
201020Q032	32	Storage by Custodial Office-SK; Initial	1.00	31.4	µg/L	H
201020Q033	33	Hallway by Room 201-BF; Initial	1.00	<1.00	µg/L	
201020Q034	34	Room 231 - Close-SK; Initial	1.00	5.54	µg/L	
201020Q035	35	Room 231 - Far-SK; Initial	1.00	7.55	µg/L	
201020Q036	36	Hallway by Room 220-BF; Initial	1.00	<1.00	µg/L	
201020Q037	37	Unisex Handicap Faculty Bathroom-SK; Initial	1.00	2.50	µg/L	
201020Q038	38	Faculty Bathroom-SK; Initial	1.00	2.32	µg/L	
201020Q039	39	Room 229 - Left-SK; Initial	1.00	19.5	µg/L	H
201020Q040	40	Room 229 - Right-SK; Initial	1.00	15.8	µg/L	H

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

## Appendix F



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen Sanitizing Station @ A	SK	App	3.97	10/20/2020	-	-	-	None	-	-	-
1001-2	Kitchen Sanitizing Station @ B	SK	App	1.64	10/20/2020	-	-	-	None	-	-	-
1001-3	Kitchen	WF	App		10/20/2020	-	-	-	None	Removed From Service	-	-
1001-4	Kitchen Handwash Station	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1001-5	Kitchen Island Prep Station	SK	App	4.46	10/20/2020	-	-	-	None	-	-	-
1001-6	Kitchen Island Handwash Station	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1001-7	Kitchen Pot Filler	PF	App	33.3	10/20/2020				Additional Sampling Required	Fixture Replacement	<1.0	12/4/2020
1002-1	Kitchen Bathroom @ A	SK	App	1.67	10/20/2020	-	-	-	None	-	-	-
1002-2	Kitchen Bathroom @ B	SK	App	2.56	10/20/2020	-	-	-	None	-	-	-
1003-1	East Serving Line Handwash Station	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1004-1	West Serving Line Handwash Station	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1005-1	Teacher's Faculty Room	SK	App	6.7	10/20/2020	-	-	-	None	-	-	-
1005-2	Teacher's Faculty Room	Spy	App		10/20/2020	-	-	-	None	Removed From Service	-	-
1006-1	Room 132 Trough @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1006-2	Room 132 Trough @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1007-1	Halway by Room 134	WF	App		10/20/2020	-	-	-	None	Removed From Service	-	-
1008-1	Room 134 Trough @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1008-2	Room 134 Trough @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1008-3	Room 134 Trough @ C	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1009-1	Women's Bathroom by Cafeteria @ A	SK	App	2.65	10/20/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1009-2	Women's Bathroom by Cafeteria @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1010-1	Custodial Closet by Ramp	SS	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1011-1	Room 128	SK	App	36.5	10/20/2020				Additional Sampling Required	Fixture Replacement	10.9	12/4/2020
1012-1	Hallway by Room 130	WF	App	<1.0	10/20/2020	-	-	-	None	Removed From Service	-	-
1012-2	Hallway by Room 130	BF	App	<1.0	10/20/2020	-	-	-	None	-	-	-
1013-1	Room 130 Unit @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1013-2	Room 130 Unit @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1013-3	Room 130 Unit @ C	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1013-4	Room 130 Unit @ D	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1014-1	Room 131 Counter	SK	App	10.1	10/20/2020	-	-	-	None	-	-	-
1014-2	Room 131 Counter	Spy	App	4.6	10/20/2020	-	-	-	None	-	-	-
1014-3	Room 131 Unit @ A	SK	App	6.48	10/20/2020	-	-	-	None	SIGN	-	-
1014-4	Room 131 Unit @ B	SK	App	5.12	10/20/2020	-	-	-	None	SIGN	-	-
1014-5	Room 131 Unit @ C	SK	App	4.15	10/20/2020	-	-	-	None	SIGN	-	-
1014-6	Room 131 Unit @ D	SK	App	1.86	10/20/2020	-	-	-	None	SIGN	-	-
1015-1	Hallway by Music Wing	WF	App		10/20/2020	-	-	-	None	Removed From Service	-	-
1016-1	Girl's Bathroom by Gym Unit @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1016-2	Girl's Bathroom by Gym Unit @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1017-1	Custodial Closet by Gym	SS	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1018-1	Boy's Bathroom by Gym Unit @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1018-2	Boy's Bathroom by Gym Unit @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1019-1	Lower Gym Custodial Closet by Boy's Locker Room	SS	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1020-1	Lower Gym Boy's Coach's Office Bathroom	SK	App	<1.0	10/20/2020	-	-	-	None	-	-	-
1021-1	Lower Gym Boy's Locker Room	WF	App	43.6	10/20/2020				Additional Sampling Required	Capped		
1021-2	Lower Gym Boy's Locker Room Bathroom Station @ A	SK	App	35.7	10/20/2020				Additional Sampling Required	Permanent Sign Posted		
1021-3	Lower Gym Boy's Locker Room Bathroom Station @ B	SK	App	20.3	10/20/2020				Additional Sampling Required	Permanent Sign Posted		
1022-1	Lower Gym Ice Machine Room by Boy's Locker Room	IM	App	<1.0	10/20/2020	-	-	-	None	-	-	-
1022-2	Lower Gym Ice Machine Room by Boy's Locker Room	SS	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1023-1	Team Locker Room Bathroom	SK	App	7.18	10/20/2020	-	-	-	None	-	-	-
1024-1	Team Locker Room Bathroom @ A	SK	App	11.1	10/20/2020	-	-	-	None	-	-	-
1024-2	Team Locker Room Bathroom @ B	SK	App	4.98	10/20/2020	-	-	-	None	-	-	-
1024-3	Team Locker Room	WF	App		10/20/2020	-	-	-	None	Removed From Service	-	-
1025-1	Girl's Coach's Office Bathroom	SK	App	19.7	10/20/2020				Additional Sampling Required	Permanent Sign Posted		
1026-1	Lower Gym Girl's Coach's Office Bathroom	SK	App	3.67	10/20/2020	-	-	-	None	-	-	-
1027-1	Lower Gym Girl's Locker Room	WF	App	41.6	10/20/2020				Additional Sampling Required	Capped		
1027-2	Lower Gym Girl's Locker Room Bathroom @ A	SK	App	21.8	10/20/2020				Additional Sampling Required	Permanent Sign Posted		
1027-3	Lower Gym Girl's Locker Room Bathroom @ B	SK	App	42.2	10/20/2020				Additional Sampling Required	Permanent Sign Posted		
1028-1	Lower Gym Custodial Closet by Girl's Locker Room	SS	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1029-1	Upper Gym Auditorium Side	WF	App	6.82	10/20/2020	-	-	-	None	-	-	-
1029-2	Upper Gym Patio Side	WF	App		1/0/1900	-	-	-	None	Removed From Service	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1030-1	Main Office Principals Office Bathroom	SK	App	9.89	10/20/2020	-	-	-	None	-	-	-
1030-2	Main Office	WF	App	42.9	10/20/2020				Additional Sampling Required	Capped		
1030-3	Main Office Kitchenette	SK	App	6.44	10/20/2020	-	-	-	None	-	-	-
1031-1	Hallway by Elevator	WF	App	<1.0	10/20/2020	-	-	-	None	-	-	-
1031-2	Hallway by Elevator	BF	App	<1.0	10/20/2020	-	-	-	None	-	-	-
1032-1	Room 103 Teacher's Station	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1032-2	Room 103 Counter 1 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1032-3	Room 103 Counter 1 @ B	SK	N/A		#REF!	-	-	-	Sign Required	-	-	-
1032-4	Room 103 Counter 1 @ C	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1032-5	Room 103 Counter 2 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1032-6	Room 103 Counter 2 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1032-7	Room 103 Counter 2 @ C	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1032-8	Room 103 Counter 2 @ D	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1033-1	Room 102 Teacher's Counter	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1033-2	Room 102 Counter 1 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1033-3	Room 102 Counter 1 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1033-4	Room 102 Counter 1 @ C	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1033-5	Room 102 Counter 1 @ D	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1033-6	Room 102 Counter 2 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1033-7	Room 102 Counter 2 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1033-8	Room 102 Counter 2 @ C	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1034-1	Room 101 Teacher's Counter	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1034-2	Room 101 Counter 1 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1034-3	Room 101 Counter 1 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1034-4	Room 101 Counter 1 @ C	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1034-5	Room 101 Counter 2 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1034-6	Room 101 Counter 2 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1034-7	Room 101 Counter 2 @ C	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1034-8	Room 101 Counter 2 @ D	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1035-1	Hallway by Room 109	WF	App		10/20/2020	-	-	-	None	Removed From Service	-	-
1936-1	Girl's Bathroom by Room 110 Counter @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1036-2	Girl's Bathroom by Room 110 Counter @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1036-3	Girl's Bathroom by Room 110 Counter @ C	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1037-1	Custodian Closet by Room 110	SS	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1038-1	Boy's Bathroom by Room 110 Counter @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1038-2	Boy's Bathroom by Room 110 Counter @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1038-3	Boy's Bathroom by Room 110 Counter @ C	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1039-1	Hallway by Group Instruction	WF	App		10/20/2020	-	-	-	None	Removed From Service	-	-
1040-1	Men's Faculty Bathroom by Room 118	SK	App	<1.0	10/20/2020	-	-	-	None	-	-	-
1041-1	Women's Faculty Bathroom by Room 119	SK	App	<1.0	10/20/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1042-1	Hallway by Room 121	WF	App		10/20/2020	-	-	-	None	Removed From Service	-	-
1043-1	Girl's Bathroom by Room 123 Counter @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1043-2	Girl's Bathroom by Room 123 Counter @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1043-3	Girl's Bathroom by Room 123 Counter @ C	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1044-1	Custodian Closet by Room 123	SS	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1045-1	Boy's Bathroom by Room 123 Counter @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1045-2	Boy's Bathroom by Room 123 Counter @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1045-3	Boy's Bathroom by Room 123 Counter @ C	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
1046-1	Nurses Office Handwash	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1046-2	Nurses Office Bathroom	SK	App	10.2	10/20/2020	-	-	-	None	-	-	-
1047-1	Room 127 Teacher's Station	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1047-2	Room 127 Counter @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1047-3	Room 127 Counter @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1047-4	Room 127 Counter @ C	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1047-5	Room 127 Counter @ D	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1047-6	Room 127 Counter @ E	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1047-7	Room 127 Counter @ F	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1047-8	Room 127 Counter @ G	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1048-1	Room 126 Teacher's Station	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1048-2	Room 126 Counter @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1048-3	Room 126 Counter @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1048-4	Room 126 Counter @ C	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1048-5	Room 126 Counter @ D	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1048-6	Room 126 Counter @ E	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1048-7	Room 126 Counter @ F	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1048-8	Room 126 Counter @ G	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1049-1	Hallway by Room 126	WF	App		10/20/2020	-	-	-	None	Removed From Service	-	-
1050-1	Room 125 Table @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1050-2	Room 125 Table @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1051-1	Men's Bathroom by Faculty Room	SK	App	<1.0	10/20/2020	-	-	-	None	-	-	-
1052-1	Women's Bathroom by Faculty Room	SK	App	<1.0	10/20/2020	-	-	-	None	-	-	-
1053-1	Chief Custodian Office Storage	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
1054-1	Custodian Break Room Bathroom	SK	App	4.48	10/20/2020	-	-	-	None	-	-	-
1055-1	Boiler Room	SS	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2001-1	Boy's Bathroom by Room 228 Unit @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2001-2	Boy's Bathroom by Room 228 Unit @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2001-3	Boy's Bathroom by Room 228 Unit @ C	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2002-1	Custodian Closet by Room 228	SS	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2003-1	Girl's Bathroom by Room 228 Unit @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2003-2	Girl's Bathroom by Room 228 Unit @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2003-3	Girl's Bathroom by Room 228 Unit @ C	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2004-1	Hallway by Room 228	WF	App		10/20/2020	-	-	-	None	Removed From Service	-	-
2004-2	Hallway by Room 229	BF	App	<1.0	10/20/2020	-	-	-	None	-	-	-
2005-1	Women's Faculty Bathroom by Room 200	SK	App	2.99	10/20/2020	-	-	-	None	-	-	-
2006-1	Men's Faculty Bathroom by Room 201	SK	App	2.25	10/20/2020	-	-	-	None	-	-	-
2007-1	Hallway by Room 220	WF	N/A		10/20/2020	-	-	-	None	Removed From Service	-	-
2008-1	Boy's Bathroom by Room 214 Unit @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2008-2	Boy's Bathroom by Room 214 Unit @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2008-3	Boy's Bathroom by Room 214 Unit @ C	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2009-1	Custodian Closet by Room 214	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2010-1	Girl's Bathroom by Room 214 Unit @ A	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2010-2	Girl's Bathroom by Room 214 Unit @ B	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2010-3	Girl's Bathroom by Room 214 Unit @ C	SK	N/A		10/20/2020	-	-	-	Mixed Valve Sampling Not Required	-	-	-
2011-1	Hallway by Room 211	WF	App		10/20/2020	-	-	-	None	Removed From Service	-	-
2012-1	Room 205 Teacher's Station	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-2	Room 205 Counter	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-3	Room 205 Pod 1 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-4	Room 205 Pod 1 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-5	Room 205 Pod 2 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-6	Room 205 Pod 2 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2012-7	Room 205 Pod 3 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-8	Room 205 Pod 3 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-9	Room 205 Pod 4 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-10	Room 205 Pod 4 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-11	Room 205 Pod 5 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-12	Room 205 Pod 5 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-13	Room 205 Pod 6 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-14	Room 205 Pod 6 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-15	Room 205 Pod 7 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-16	Room 205 Pod 7 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2012-17	Room 205 Prep Room Counter	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2013-1	Room 204 Teacher's Station	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2013-2	Room 204 Counter	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2013-3	Room 204 Pod 1 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2013-4	Room 204 Pod 1 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2013-5	Room 204 Pod 2 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2013-6	Room 204 Pod 2 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2013-7	Room 204 Pod 3 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2013-8	Room 204 Pod 3 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2013-9	Room 204 Pod 4 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2013-10	Room 204 Pod 4 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2013-11	Room 204 Pod 5 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2013-12	Room 204 Pod 5 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2013-13	Room 204 Pod 6 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2013-14	Room 204 Pod 6 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2013-15	Room 204 Pod 7 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2013-16	Room 204 Pod 7 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2013-17	Room 204 Prep Room Counter	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2014-1	Room 203 Teacher's Station	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2014-2	Room 203 Counter	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2014-3	Room 203 Pod 1 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2014-4	Room 203 Pod 1 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2014-5	Room 203 Pod 2 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2014-6	Room 203 Pod 2 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2014-7	Room 203 Pod 3 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2014-8	Room 203 Pod 3 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2014-9	Room 203 Pod 4 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2014-10	Room 203 Pod 4 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2014-11	Room 203 Pod 5 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2014-12	Room 203 Pod 5 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2014-13	Room 203 Pod 6 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2014-14	Room 203 Pod 6 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2014-15	Room 203 Pod 7 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2014-16	Room 203 Pod 7 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2015-1	Room 202 Teacher's Station	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2015-2	Room 202 Counter	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2015-3	Room 202 Pod 1 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2015-4	Room 202 Pod 1 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2015-5	Room 202 Pod 2 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2015-6	Room 202 Pod 2 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2015-7	Room 202 Pod 3 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2015-8	Room 202 Pod 3 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2015-9	Room 202 Pod 4 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2015-10	Room 202 Pod 4 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2015-11	Room 202 Pod 5 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2015-12	Room 202 Pod 5 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2015-13	Room 202 Pod 6 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2015-14	Room 202 Pod 6 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2015-15	Room 202 Pod 7 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2015-16	Room 202 Pod 7 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 <sup>st</sup> Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2015-17	Room 202 Prep Room Counter	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2016-1	Room 201 Teacher's Station	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2016-2	Room 201 Counter	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2016-3	Room 201 Pod 1 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2016-4	Room 201 Pod 1 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2016-5	Room 201 Pod 2 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2016-6	Room 201 Pod 2 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2016-7	Room 201 Pod 3 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2016-8	Room 201 Pod 3 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2016-9	Room 201 Pod 4 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2016-10	Room 201 Pod 4 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2016-11	Room 201 Pod 5 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2016-12	Room 201 Pod 5 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2016-13	Room 201 Pod 6 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2016-14	Room 201 Pod 6 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2016-15	Room 201 Pod 7 @ A	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-
2016-16	Room 201 Pod 7 @ B	SK	N/A		10/20/2020	-	-	-	Sign Required	-	-	-

**Laboratory Report**

NYE Report #: 2204241-15962

October 22, 2020

Project Manager  
Enviroscience Consultants, Inc.  
2150 Smithtown Avenue  
Ronkonkoma, NY 11779

Project: Comsewogue High School

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on October 20, 2020. New York Environmental analyzed the samples on October 21, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



---

Li Tsang, Laboratory Director

Date Collected:	20 Oct 2020
Date Received:	20 Oct 2020
Date Analyzed:	21 Oct 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201020Q045	1	Kitchen Sanitizing Station @ A-SK; Initial	1.00	3.97	µg/L	
201020Q046	2	Kitchen Sanitizing Station @ B-SK; Initial	1.00	1.64	µg/L	
201020Q047	3	Kitchen Island Prep Station-SK; Initial	1.00	4.46	µg/L	
201020Q048	4	Kitchen Pot Filler-PF; Initial	1.00	33.3	µg/L	H
201020Q049	5	Kitchen Bathroom @ A-SK; Initial	1.00	1.67	µg/L	
201020Q050	6	Kitchen Bathroom @ B-SK; Initial	1.00	2.56	µg/L	
201020Q051	7	Teacher's Faculty Room-SK; Initial	1.00	6.70	µg/L	
201020Q052	8	Women's Bathroom by Cafeteria @ A-SK; Initial	1.00	2.65	µg/L	
201020Q053	9	Room 128-SK; Initial	1.00	36.5	µg/L	H
201020Q054	10	Hallway by Room 130-WF; Initial	1.00	<1.00	µg/L	
201020Q055	11	Hallway by Room 130-BF; Initial	1.00	<1.00	µg/L	
201020Q056	12	Room 131 Counter-SK; Initial	1.00	10.1	µg/L	
201020Q057	13	Room 131 Counter-Spy; Initial	1.00	4.60	µg/L	
201020Q058	14	Room 131 Unit @ A-SK; Initial	1.00	6.48	µg/L	
201020Q059	15	Room 131 Unit @ B-SK; Initial	1.00	5.12	µg/L	
201020Q060	16	Room 131 Unit @ C-SK; Initial	1.00	4.15	µg/L	
201020Q061	17	Room 131 Unit @ D-SK; Initial	1.00	1.86	µg/L	
201020Q062	18	Lower Gym Boy's Coach's Office Bathroom-SK; Initial	1.00	<1.00	µg/L	
201020Q063	19	Lower Gym Boy's Locker Room -WF; Initial	1.00	43.6	µg/L	H
201020Q064	20	Lower Gym Boy's Locker Room Bathroom Station @ A-SK; Initial	1.00	35.7	µg/L	H
201020Q065	21	Lower Gym Boy's Locker Room Bathroom Station @ B-SK; Initial	1.00	20.3	µg/L	H
201020Q066	22	Lower Gym Ice Machine Room by Boy's Locker Room-IM; Initial	1.00	<1.00	µg/L	
201020Q067	23	Team Locker Room Bathroom-SK; Initial	1.00	7.18	µg/L	
201020Q068	24	Team Locker Room Bathroom Station @ A-SK; Initial	1.00	11.1	µg/L	
201020Q069	25	Team Locker Room Bathroom Station @ B-SK; Initial	1.00	4.98	µg/L	
201020Q070	26	Girls Coach's Office Bathroom- SK; Initial	1.00	19.7	µg/L	H



Date Collected:	20 Oct 2020
Date Received:	20 Oct 2020
Date Analyzed:	21 Oct 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201020Q071	27	Lower Gym Girl's Coachs Office Bathroom-SK; Initial	1.00	3.67	µg/L	
201020Q072	28	Lower Gym Girl's Locker Room-WF; Initial	1.00	41.6	µg/L	H
201020Q073	29	Lower Gym Girl's Locker Room Bathroom Station @ A-SK; Initial	1.00	21.8	µg/L	H
201020Q074	30	Lower Gym Girl's Locker Room Bathroom Station @ B-SK; Initial	1.00	42.2	µg/L	H
201020Q075	31	Upper Gym Auditorium Side-WF; Initial	1.00	6.82	µg/L	
201020Q076	32	Main Office Principals Office Bathroom-SK; Initial	1.00	9.89	µg/L	
201020Q077	33	Main Office -WF; Initial	1.00	42.9	µg/L	H
201020Q078	34	Main Office Kitchenette-SK; Initial	1.00	6.44	µg/L	
201020Q079	35	Hallway by Elevator-WF; Initial	1.00	<1.00	µg/L	
201020Q080	36	Hallway by Elevator-BF; Initial	1.00	<1.00	µg/L	
201020Q081	37	Men's Faculty Bathroom by Room 118-SK; Initial	1.00	<1.00	µg/L	
201020Q082	38	Women's Faculty Bathroom by Room 119-SK; Initial	1.00	<1.00	µg/L	
201020Q083	39	Nurses Office Bathroom-SK; Initial	1.00	10.2	µg/L	
201020Q084	40	Men's Bathroom by Faculty Room-SK; Initial	1.00	<1.00	µg/L	
201020Q085	41	Women's Bathroom by Faculty Room-SK; Initial	1.00	<1.00	µg/L	
201020Q086	42	Custodian Break Room Bathroom-SK; Initial	1.00	4.48	µg/L	
201020Q087	43	Hallway by Room 228-WF; Initial	1.00	<1.00	µg/L	
201020Q088	44	Hallway by Room 229-BF; Initial	1.00	<1.00	µg/L	
201020Q089	45	Women's Faculty Bathroom by Room 200-SK; Initial	1.00	2.99	µg/L	
201020Q090	46	Men's Faculty Bathroom by Room 201-SK; Initial	1.00	2.25	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.



## Laboratory Report

NYE Report #: 2204859-16375

December 9, 2020

Project Manager  
Enviroscience Consultants, Inc.  
2150 Smithtown Avenue  
Ronkonkoma, NY 11779

Project: Comsewogue High School

Dear Project Manager,


Enclosed is the Laboratory Analytical Report for potable water sample(s) received on December 04, 2020. New York Environmental analyzed the samples on December 07, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,



---

Li Tsang, Laboratory Director



Date Collected:	03 Dec 2020
Date Received:	04 Dec 2020
Date Analyzed:	07 Dec 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
201204Q016	1	Kitchen Pot Filler-PF; Initial	1.00	<1.00	µg/L	
201204Q017	2	Rm 128-SK; Initial	1.00	10.9	µg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation